PELLA VINYL EAST PRODUCT TROUBLE SHOOTING GUIDE

Table of Contents

Encompass by Pella™ 2/2008 - Current, ThermaStar by Pella® 2003 - 01/2022 and Centera by Pella™ 2/2007 - 2/2012

AWNING/CASEMENT
- Air Infiltration Issues 3
- Operational Issues
  - Difficult to open, close or lock 6

Basement Hopper
- Air Infiltration 9
- Operational/Locking Issues 10


Double-Hung
- Air Infiltration 11
- Operational Issues
  - Difficult to raise and lower sash 13
  - Locking 15

Single-Hung
- Air Infiltration 17
- Operational Issues
  - Difficult to raise and lower sash 19
  - Locking 20

Sliding Window (Including Basement Sliding Window)
- Air Infiltration 22
- Operational Issues
  - Difficult to open and close 24
  - Locking 26

Sliding Door
- Air Infiltration 27
- Operational Issues
  - Vent Panel 29
  - Locking 31
  - Blinds Between the Glass 32
  - Sliding Flat Screen 33
  - Screen Latching Issues 35

All Vinyl Products
- Cleaning and Other Issues 36

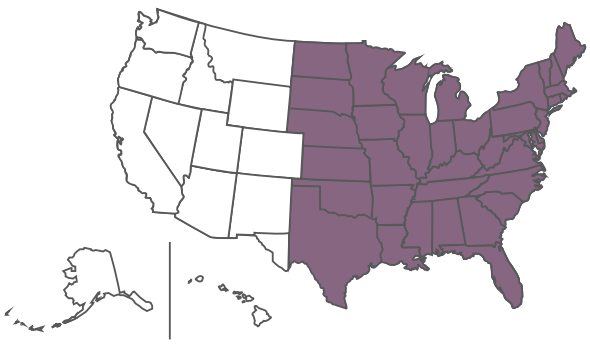


© 2022 Pella Corporation

PELLA VINYL EAST PRODUCT TROUBLE SHOOTING GUIDE

SYMBOLS KEY	
	The hard hat icon indicates a Service Technician is required.

Each topic's issues and answers in the troubleshooting guide are presented with the easier ones to detect and correct first, which a homeowner could typically perform, progressing to the more challenging issues requiring a service technician.

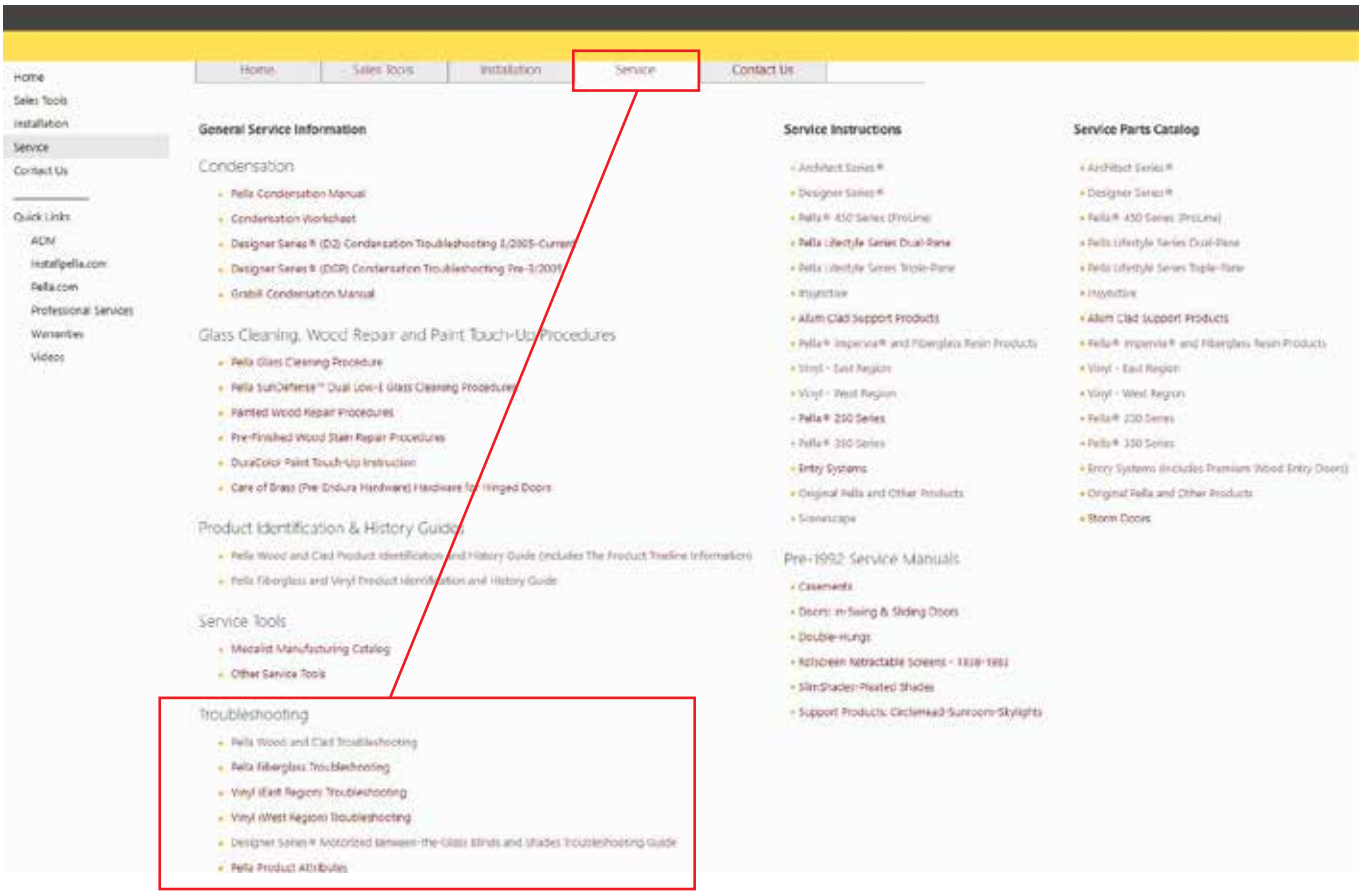

© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Lock not fully engaged; lock lever not completely in locked position.

ANSWER: Push lock lever down to locked position.

Awning



Unlocked Position



Locked Position

Casement



Unlocked Position



Locked Position

ISSUE: Lock lever in down or locked position, however sash not engaged.

ANSWER: Use crank handle to open sash; lift lock lever, close sash and engage lock lever again. If the sash won't close far enough to engage the lock, the sash may be bowed or the window may be installed out of plumb.

Awning



Casement



ISSUE: Frame weatherstrip not completely "seated" into frame.

ANSWER: Use a putty knife to press the barb of the weatherstrip into the kerf.

Awning



Casement



ISSUE: Sash does not pull tight against frame weatherstrip when locked.

ANSWER: Adjust the sash strike by removing screws and reinstalling in a different hole to pull the sash tighter against the frame weatherstrip.

Casement





© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Sash weatherstrip not completely "seated" into sash.

ANSWER: Seat the weatherstrip into the kerf on the edge of the sash.

See PERL for service instruction "Weatherstrip Replacement"





ISSUE: Frame weatherstrip is damaged or brittle.


ANSWER: Open sash and inspect frame weatherstrip; replace if it's brittle or damaged.

See PERL for service instruction "Weatherstrip Replacement"



ISSUE: Sash to frame reveal is not even, when viewed from exterior.

ANSWER 1: Check unit for square by measuring diagonals. Open sash and check operating hardware (including roto, hinges and pivot arms) for damage. Replace hardware as needed.

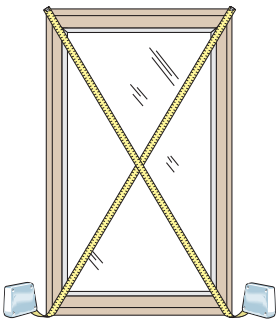


ANSWER 2: Remove and reinstall sash to correct reveal – check diagonals of entire unit if needed. If the frame is out of square, installer needs to be involved. (Discuss with your manager).



© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Gap in corner of frame weatherstrip.

ANSWER: Replace weatherstrip.

See PERL for service instruction "Weatherstrip Replacement"



© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Dirt and debris in sill frame hinge slide area.

ANSWER: Clean hinge slide and sill frame using a small brush and follow with soapy water, let dry and use silicone spray or similar on the slide.



ISSUE: Crank handle is stripped.

ANSWER: Replace stripped crank handle.



Stripped Crank Handle



Intact Crank Handle

ISSUE: Sash does not move when crank handle is turned because window is locked.

ANSWER: Lift up on lock handle to unlock window.

Awning



Unlocked Position



Locked Position

Casement



Unlocked Position



Locked Position

ISSUE: Lock is loose, broken or damaged.

ANSWER: Tighten loose screws or replace broken or damaged lock handle.

Awning





© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Sash strike and sash lock do not align properly.

ANSWER: Loosen the sash strike screws, adjust strike position and re-tighten screws.

Awning



ISSUE: Operator arm not attached correctly to sash hook on bottom side of awning sash.

ANSWER: Align sash hook with slots in the arm, push the catch in place to hold the arm on the hook.






ISSUE: Roto operator is broken or gears are stripped.

ANSWER: Replace roto operator.

See PERL for service instruction "Roto Operator Replacement"

Casement





ISSUE: Roto hardware or operator arm is bent or damaged.

ANSWER: Replace bent or damaged roto hardware.

See PERL for service instruction "Roto Operator Replacement"

Awning

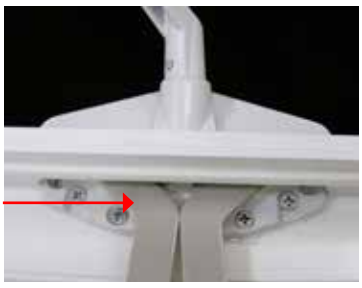

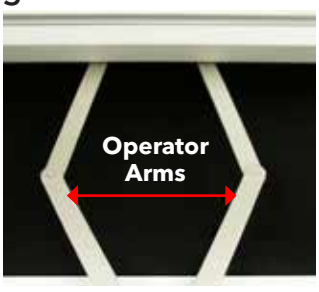

© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).


ISSUE: Hinge arm is bent or damaged.

ANSWER: Replace stripped crank handle.

Awning



Casement

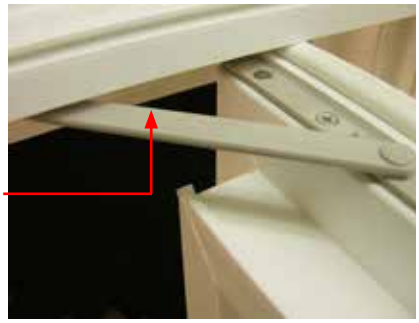

© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Lock is loose allowing sash movement.

ANSWER: Tighten loose lock screws.



ISSUE: Sash weatherstrip is damaged, loose or missing.

ANSWER 1: If weatherstrip is only loose, reinstall weatherstrip, use sealant if necessary to hold in place.


ANSWER 2: Replace sash.

See PERL for service instructions "Weatherstrip Replacement".



ISSUE: Frame installed out of square.

ANSWER: Check diagonals of unit they need to be within an 1/8" of each other.

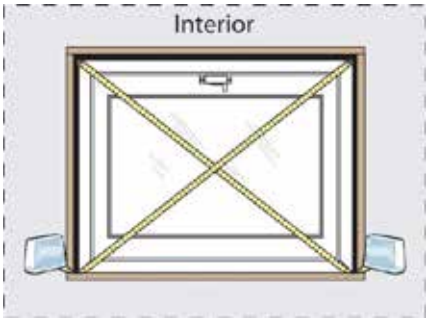

ISSUE: Frame is not shimmed properly allowing air flow around the sash/frame area.

ANSWER: Sometimes a visual check of interior sash to frame contact will reveal where unit frame has not been shimmed properly at the sill or at the jambs. Check for bow using level or straight edge. Interior trim may need to be removed to add shims (by the installer).



© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Hinge hardware is bent or broken.

ANSWER: Replace hinge hardware.

See PERL for service instructions "Hinge Replacement"



ISSUE: Lock is broken.

ANSWER: Replace lock.

See PERL for service instructions "Lock Replacement"



© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Lock and keeper/strike not fully engaged.

ANSWER: Make sure sash(es) are in closed position and lock the unit and make sure the lock lever is completely in the locked position.





ISSUE: Lock is loose allowing movement.

ANSWER: Tighten loose lock screws.



ISSUE: Keeper/strike is loose allowing movement.

ANSWER: Tighten loose keeper/strike screws.



ISSUE: Sash weatherstrip is damaged or missing.

ANSWER: Replace sash weatherstrip.

See PERL for service instructions
"Stile Weatherstrip Replacement"
or
"Weatherstrip Enhancement"




© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Foam balance pocket plug at sill is damaged or missing.

ANSWER: Replace foam plug.

See PERL for service instructions "Weatherstrip Enhancement"

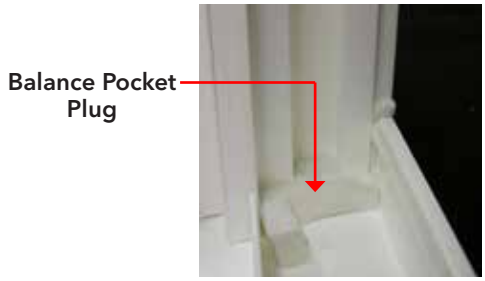

ISSUE: Window is slightly out of square.

ANSWER: Add weatherstrip enhancements.

See PERL for service instructions "Weatherstrip Enhancement"



Add fin seal weatherstrip to frame on double-hung and single-hung units.




Add fin seal weatherstrip to sash at the check rail on single-hung units.



Add dust plug weatherstrip to lower sash at check rail on replacement double-hung units.

ISSUE: Frame is not shimmed properly allowing air flow around the sash/frame area.


ANSWER: Sometimes a visual check of interior sash to frame contact will reveal where unit frame is too wide and not shimmed. Check jambs for bow using level or straightedge. Also measure width of window at top middle and bottom, these measurements need to be very close. Interior trim may need to be removed to add shims at checkrail area (by the installer!)

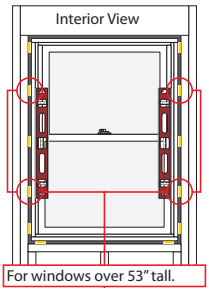

Circled shims indicate locations of additional required shims at midpoints on vertical jambs of units over 53" tall.

ISSUE: Unit is installed out of square not allowing adequate sash to frame contact.

ANSWER: Check diagonals of unit they need to be within an 1/8" of each other.

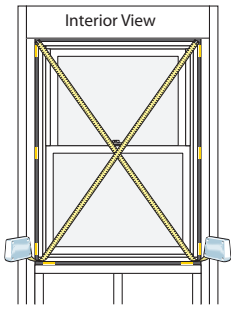

© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Upper vent stop is extended or broken blocking sash movement.

ANSWER 1: Push in the stop to allow sash clearance.
ANSWER 2: Replace upper vent stop.

See PERL for service instructions "Upper Vent Stop Replacement"





ISSUE: Sash balance cord is disconnected from frame.

ANSWER: Reattach hook at end of balance cord to the frame.

See PERL for service instructions "Sash Balance Replacement"



ISSUE: Sash balance is damaged or broken.


ANSWER: Replace sash balance.

See PERL for service instructions "Sash Balance Replacement"



ISSUE: Unit is installed out of square or plumb causing sash to bind in frame.

ANSWER: Measure diagonals of window to check window installation for square, each measurement should be within 1/8". Additionally measure the window width at the top, middle and bottom of the window. If the middle measurement is large, this indicates a reverse hourglass frame condition and shim(s) need to be added at the checkrail.

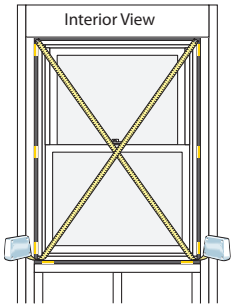


If unit is trimmed out, tech will need to get installer involved following proper channels. If trim is not installed, add/subtract shims as needed.

© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Frame is not shimmed properly (over shimmed) causing sash raise and lower issues.

ANSWER: Measure the window at the top, middle and bottom of the window. If the middle measurement is smaller, this indicates and hour-glassed frame condition , and shims need to be removed at the check rail. Installer must be contacted to remove and reinstall window so it is properly shimmed and is plumb, level and square. (Discuss with your manager.)

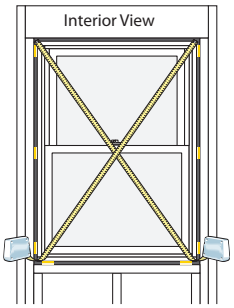

ISSUE: Debris on sash weatherstrip.

ANSWER: Vacuum and clean pile weatherstrip on sash.





ISSUE: Locking pivot bar is misplaced, broken or damaged.

ANSWER: Make sure bar is fully seated or replace pivot bar if needed.

See PERL for service instructions "Pivot Bar Replacement"



© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Lock hard to operate or difficult to pivot, lubrication needed.

ANSWER: Apply Door Ease® or similar lubricant to the lock and keeper/strike area. If lock is broken, replace lock and or keeper/strike.




ISSUE: Dirt or debris on frame sill not allowing full closure of bottom sash.

ANSWER: Clean or brush entire length of the sill area to remove debris.



ISSUE: Unit has been improperly shimmed in center of sill creating a 'humped' sill making it difficult to lock window.

ANSWER: Check unit with level to determine if units need to be reinstalled or casing removed to access improperly installed shims.

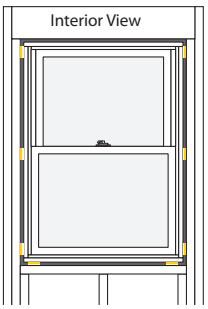


Shim in yellow locations noted in illustration, not near center of the frame sill. Shims at the sill should only be under each vertical jamb.

© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Unit may not be installed plumb, level and square in the opening.

ANSWER: Check diagonals of unit they need to be within an 1/8" of each other.

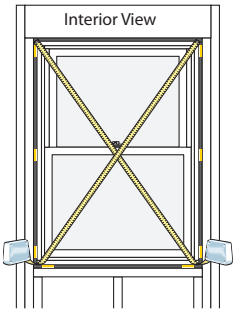

ISSUE: Vent sash is bowed.

ANSWER: Place a straightedge on interlocker/checkrail, if bowed >3/32" – replace the sash.

See PERL for service instructions "Sash Replacement"



© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Lock and keeper/strike not fully engaged.

ANSWER: Make sure sash(es) are in closed position and lock the unit and make sure the lock lever is completely in the locked position.





ISSUE: Lock is loose allowing movement.

ANSWER: Tighten loose lock screws.



ISSUE: Keeper/strike is loose allowing movement.

ANSWER: Tighten loose keeper/strike screws.



ISSUE: Sash weatherstrip is damaged or missing.

ANSWER: Replace sash weatherstrip.

See PERL for service instructions
"Stile Weatherstrip Replacement"
or
"Weatherstrip Enhancement"




© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Frame is not shimmed properly allowing air flow around the sash / frame area.


ANSWER: Sometimes a visual check of interior sash to frame contact will reveal where unit frame is too wide and not shimmed. Check jambs for bow using level or straightedge. Also measure width of window at top middle and bottom, these measurements need to be very close. Interior trim may need to be removed to add shims at checkrail area (by the installer!).

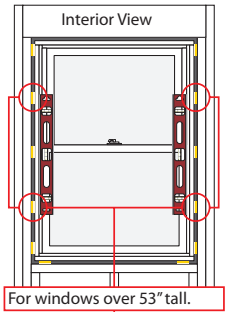

Circled shims indicate locations of additional required shims at midpoints on vertical jambs of units over 53" tall.

ISSUE: Unit is installed out of square not allowing adequate sash to frame contact.

ANSWER: Check diagonals of unit they need to be within an 1/8" of each other.

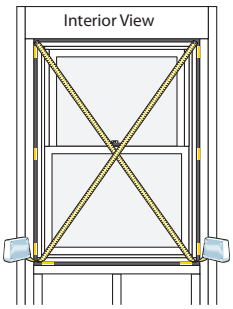

© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Sash balance cord is disconnected from frame.


ANSWER: Reattach hook at end of balance cord to the frame.

See PERL for service instructions "Sash Balance Replacement"



ISSUE: Unit is installed out of square or plumb causing sash to bind in frame.

ANSWER: Measure diagonals of window to check window installation for square, each measurement should be within 1/8". Additionally measure the window width at the top, middle and bottom of the window. If the middle measurement is large, this indicates a reverse hourglass frame condition and shim(s) need to be added at the checkrail.

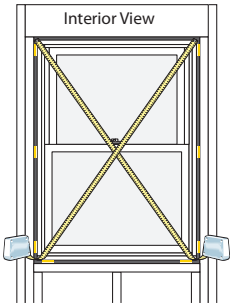

If unit is trimmed out, tech will need to get installer involved following proper channels. If trim is not installed, add/subtract shims as needed.

ISSUE: Sash balance is damaged or broken.


ANSWER: Replace sash balance.

See PERL for service instructions "Sash Balance Replacement"



ISSUE: Frame is not shimmed properly (over shimmed) causing sash raise and lower issues.

ANSWER: Measure the window at the top, middle and bottom of the window. If the middle measurement is smaller, this indicates an hour-glassed frame condition , and shims need to be removed at the check rail. Installer must be contacted to remove and reinstall window so it is properly shimmed and is plumb, level and square. (Discuss with your manager.)

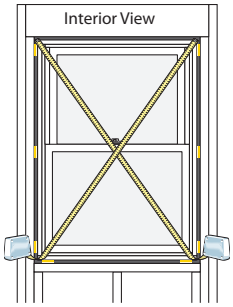

© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Lock hard to operate or difficult to pivot, lubrication needed.

ANSWER: Apply Door Ease® or similar lubricant to the lock and keeper/strike area. If lock is broken, replace lock and or keeper/strike.



ISSUE: Dirt or debris on frame sill not allowing full closure of bottom sash.

ANSWER: Clean or brush entire length of the sill area to remove debris.



ISSUE: Lock latch not aligned with keeper/strike.

ANSWER: Loosen keeper/strike screws, adjust keeper/strike position, re-tighten screws.



ISSUE: Lock or keeper/strike is broken.

ANSWER: Replace lock keeper/strike.

See PERL for service instructions "Lock and Keeper Replacement"






© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Unit has been improperly shimmed in center of sill creating a 'humped' sill making it difficult to lock window.


ANSWER: Check unit with level to determine if units need to be reinstalled or casing removed to access improperly installed shims.

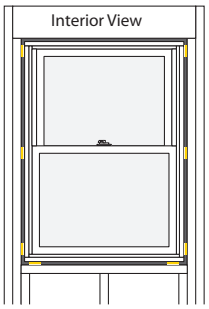

Shim in yellow locations noted in illustration, not near center of the frame sill. Shims at the sill should only be under each vertical jamb.

ISSUE: Unit may not be installed plumb, level and square in the opening.

ANSWER: Check diagonals of unit they need to be within an 1/8" of each other.

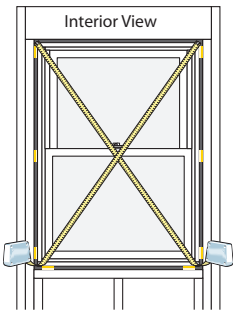

ISSUE: Vent sash is bowed.

ANSWER: Place a straightedge on interlocker/checkrail, if bowed >3/32" – replace the sash.

See PERL for service instructions "Sash Replacement"



Note: Double-Hung shown.

© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Lock latch does not align with keeper/strike.

ANSWER: Loosen keeper screws to realign, re-tighten screws.

See PERL for service instructions "Lock and Keeper Replacement"



ISSUE: Frame or venting sash slightly out of square causing gap at checkrail.


ANSWER: Replace rollers in the housing on one end of the venting sash.





ISSUE: Frame installed out of square.

ANSWER: Check diagonals of unit they need to be within an 1/8" of each other.

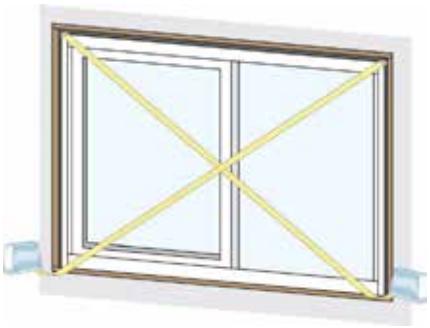

ISSUE: Frame is not shimmed properly allowing air flow around the sash/frame area.

ANSWER: Sometimes a visual check of interior sash to frame contact will reveal where unit frame has not been shimmed properly at the sill or at the jambs. Check for bow using level or straight edge. Interior trim may need to be removed to add shims (by the installer).



© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Lock and strike / keeper are loose allowing movement.

ANSWER: Tighten lock screws, remove vent sash to access strike/keeper and tighten screws. Replace if needed.

See PERL for service instructions "Sash Replacement"



© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Dirt and debris in sill track.

ANSWER: Clean dirt and debris out of track.



ISSUE: Sill track not completely snapped into frame.

ANSWER: Remove sliding sash and press firmly along the length of the track to snap if into place.

See PERL for service instructions "Sill Track Replacement"




ISSUE: Sliding sash catching on anti-lift clips.

ANSWER 1: Press firmly on anti-lift clips to endure they are fully snapped into place.

ANSWER 2: Make sure the sill track is completely pressed into place.

Clip Blocking Sash Travel

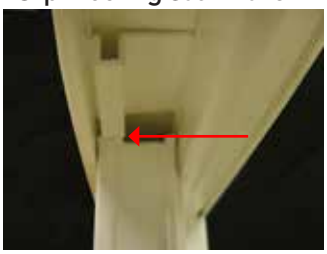



Sash Travel Past Clip



ISSUE: Rollers are broken or worn out.

ANSWER: Replace the rollers and housing.

See PERL for service instructions "Roller Housing Replacement"




© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Frame improperly shimmed.

ANSWER: Measure window at three locations, measurements need to be within 1/16". Interior trim will need to be removed to add or remove shims as needed (by the installer!)

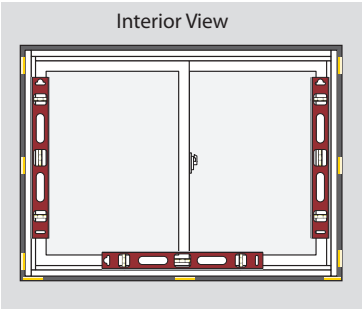

© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Lock latch does not align with keeper/strike.

ANSWER: Loosen keeper screws to realign, re-tighten screws.

See PERL service instruction "Lock and Keeper Replacement"



ISSUE: Lock or keeper/strike is broken.

ANSWER: Replace lock or keeper/strike.

See PERL service instruction "Lock and Keeper Replacement"





ISSUE: Lock hard to operate or difficult to pivot, lubrication needed.

ANSWER: Apply Door Ease® or similar lubricant to the lock/strike area. If lock is broken, replace lock and or strike.



© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Door is not locked and secured tightly.

ANSWER: Close and lock the door.



Close the door



Engage the thumb turn

ISSUE: Lock does not align with keeper/strike correctly.

ANSWER 1: Adjust the "throw"/"reach" of the mortise lock.
ANSWER 2: Replace or adjust keeper/strike.
ANSWER 3: Adjust panel rollers.

See PERL for service instruction "Lock Adjustment", "Keeper Replacement" or "Roller Adjustment"






ISSUE: Panel rollers need adjustment.

ANSWER: Adjust rollers by turning the adjustment screw clockwise (to raise a side of the door panel) or counter-clockwise (to lower it).

See PERL for service instruction "Rollers Adjustment"

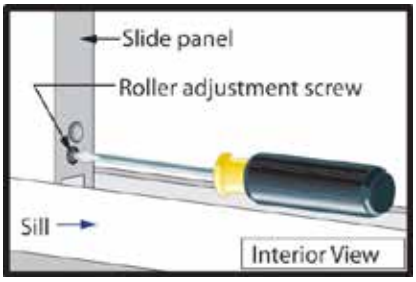

ISSUE: Vent panel weatherstrip is damaged, loose or missing.

ANSWER: Replace door panel weatherstrip.

See PERL service instruction "Stile Weatherstrip Replacement - Double-Hung"

Note: Process for door panel weatherstrip replacement is similar to DH.




© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).


ISSUE: Door installed out of plumb and square.

ANSWER: Check diagonals, if difference is >1/8", contact installer to correct.

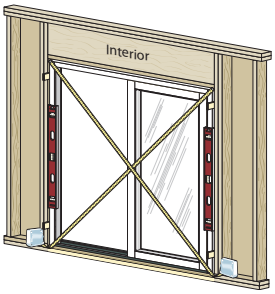

ISSUE: Door shimmed incorrectly causing strike and lock misalignment.

ANSWER: Measure width of door at top, middle and bottom; measurements need to be within 1/16". Interior trim may need to be removed to add or remove shims as needed (by the installer).

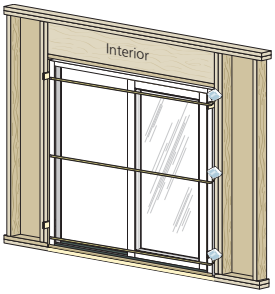

© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Dirt and debris on the sill track


ANSWER: Use brush, broom or vacuum to clean track area. Lubricate sill with dry silicone spray or similar product.



ISSUE: Panel rollers need adjustment.

ANSWER: Adjust rollers by turning the adjustment screw clockwise (to raise a side of the door panel) or counter-clockwise (to lower it).

See PERL for service instruction "Rollers Adjustment"

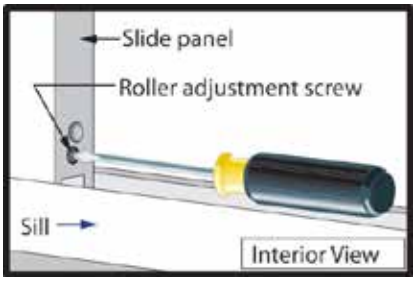

ISSUE: Dirt or debris under sill track.

ANSWER: Remove sill track and use brush, broom or vacuum to clean under sill track.

See PERL for service instruction "Sill Track Cover Replacement"



ISSUE: Sill track cover / cap damaged.

ANSWER: Remove and replace the sill track cover / cap.



© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Rollers are worn or damaged.

ANSWER: Remove and replace the rollers.


See PERL for service instruction "Roller Replacement"

When a roller does not turn or roll as designed, the roller edge can become worn causing panel operational issues.




ISSUE: Door installed out of plumb and square.

ANSWER: Check diagonals, if difference is >1/8", contact installer to correct.

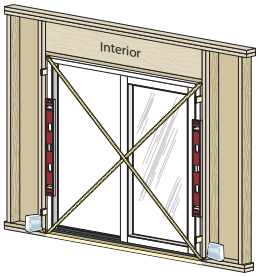

ISSUE: Door shimmed incorrectly causing strike and lock misalignment.

ANSWER: Measure width of door at top, middle and bottom; measurements need to be within 1/16". Interior trim may need to be removed to add or remove shims as needed (by the installer).

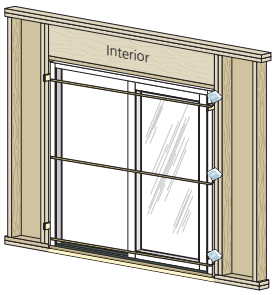

© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Door is not locked because latch lever is not in locked position.

ANSWER: Make sure latch lever is in locked position.



Unlocked



Locked

ISSUE: Latch does not make proper contact with keeper/strike.

ANSWER: Adjust the "throw"/"reach" of the mortise lock.

See PERL for service instruction "Patio Door Lock Replacement"



ISSUE: Mortise lock is broken.

ANSWER: Replace lock.

See PERL for service instruction "Patio Door Lock Replacement"




ISSUE: Panel rollers need adjusted.

ANSWER: Adjust rollers by turning the adjustment screw clockwise (to raise a side of the door panel) or counter-clockwise (to lower it).

See PERL for service instruction "Rollers Adjustment"

Lock does not align with latch/keeper because rollers

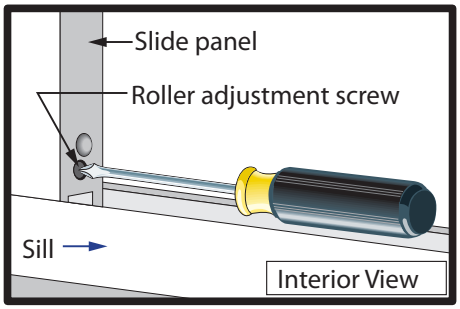

© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Bottom handle (raise & lower) and the blind out of sync.

ANSWER: Slide the handle all the way to the top of the guide track. Push through any resistance at the top as this will reset the handle for proper raise and lower operation.

See PERL for service instruction "Blinds Between the Glass-Handle and Operator Track Replacement"





ISSUE: Top handle (tilt) and the blind out of sync.

ANSWER: Slide the handle all the way to the bottom of the guide track. While sliding handle down; push through any resistance at the top as this will reset the handle for proper tilt operation.


See PERL for service instruction "Blinds Between the Glass-Handle and Operator Track Replacement"



ISSUE: Blind will not fully raise or lower.

ANSWER: Raise and lower the blind a few times to reset cord.


See PERL for "Vinyl Patio Door Blinds Operation Guidelines"

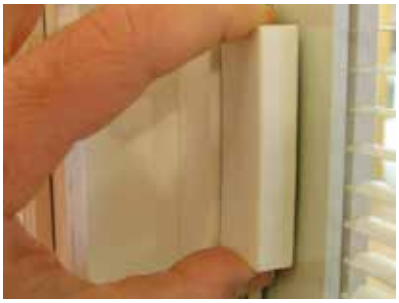

ISSUE: Blind will not lower evenly (one side tips).

ANSWER: Using the tilt operator, ensure the slats are in the open position, then raise and lower the blind a few times.

See PERL for "Vinyl Patio Door Blinds Operation Guidelines"

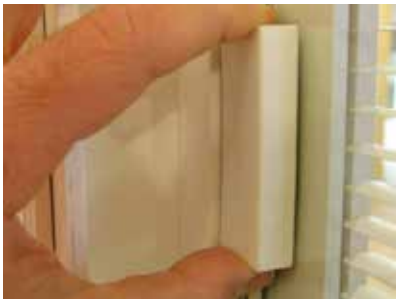

© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Screen track not fully in place.

ANSWER: Press firmly along the length of the track to ensure it is snapped fully into place.



ISSUE: Dirt and debris on the screen track.

ANSWER: Use brush, broom or vacuum to clean track area.



ISSUE: Screen not on the screen track correctly.

ANSWER: Lift screen up and move it until the rollers are on the track.



Screen not on track



Screen on track

ISSUE: Screen rollers need adjusting.

ANSWER: Adjust screen by raising or lowering the rollers using the roller adjustment screw located on the top and bottom rails of the screen door.



Standard Screen



Heavy Duty Screen

© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Dirt and debris under the screen track.

ANSWER: Remove screen, remove screen track and use brush, broom or vacuum to clean under screen track.







ISSUE: Screen rollers are worn or damaged.

ANSWER: Replace rollers, remove attachment screw, pull out roller assembly. Insert new roller assembly, attach with screw.



Standard Screen



Heavy Duty Screen

© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Screen latch does not align with keeper / strike.

ANSWER: Loosen attachment screws and adjust keeper / strike to align with latch, re-tighten screws. Keeper / strike for East Heavy Duty and West Standard and Heavy Duty Screens are slightly different style but the procedure is similar.

East Standard Screen Shown



ISSUE: Screen needs to be raised or lowered.

ANSWER: Adjust screen by raising or lowering the rollers using the roller adjustment screw located on the top and bottom rails of the screen door.



Standard Screen



Heavy Duty Screen

© 2022 Pella Corporation

POTENTIAL ISSUES AND ANSWERS (EASY TO MORE DIFFICULT).

ISSUE: Marks or scuffs on the vinyl.

ANSWER 1: Use a non-abrasive cleaner such as Soft Scrub or Bon Ami to clean the vinyl.
ANSWER 2: Consult a Tub and Shower Repair professional about other possibilities.



ISSUE: Vinyl has stucco or mortar on it after installation.

ANSWER: Use a putty knife to gently pry the deposit from the vinyl, making sure not to gouge the vinyl.

ISSUE: Crack in the 45 degree frame corner weld.

ANSWER: This is not repairable, window must be replaced.

© 2022 Pella Corporation