Pella Service Parts Catalog

# Pella® Reserve™ and Architect Series® Hung Windows

## 1990 - Current

**Contents**


Pella® Pella® Reserve™ . . . 2
Pella® Architect Series® Reserve™
Architect Series® Double-Hung - 02/2011 - Current . . . 2
Pella® Architect Series® Double-Hung - 2005 - 01/2011 . . . 3
Pella® Architect Series® Double-Hung - 1995 - 2004 . . . 4
Pella® Architect Series® Double-Hung - 1993 - 1994 . . . 5
Pella® Architect Series® Double-Hung - 1991 - 1992 . . . 6
Pella® Architect Series® Monumental-Hung - 07/2015 - Current . . . 7

**Vent Frame**

Jamb Liner Inserts . . . 8
Jamb Liner . . . 8
Insert Connector . . . 9
Jamb Pressure Spring . . . 9
Jamb Booster Spring . . . 9
P-Fit Sill Adapter . . . 9
Balance Assembly . . . 10
Head Stop . . . 13
Sash Stop . . . 13
Screw Covers . . . 13
Steady-Tilt . . . 13
HIG Clip . . . 14
Model 6 weatherstrip . . . 14
Structural Bolt . . . 14
Model 5 weatherstrip . . . 15
Model 5 Jamb Liner Mohair . . . 15
Foam Plugs . . . 16
Model 3 weatherstrip . . . 17
Sash Allowance Kits . . . 17
Model 2 weatherstrip . . . 18

**Vent Sash**

Sash Assembly . . . 19
Insulated Glass . . . 19
Sash Cladding Sets . . . 19
Interlocker . . . 19

**Vent Hardware**

Sash Terminal . . . 20
Upper Wash Lock . . . 21
Lower Wash Lock . . . 22
Lock and Strike Package . . . 23
Commercial/Monumental Hardware . . . 25
Sash Lift . . . 26
Limited Opening Hardware . . . 26
WOCD . . . 27
Sash Lugs . . . 27
Single-Hung Clip . . . 28
Windload Brace Clips . . . 28

**Screens**

Screen Assembly . . . 29
Black Spline . . . 29
Fiberglass Screen Cloth . . . 29
Pull Tab . . . 29
Upper Screen Clip . . . 30
Screen Clips . . . 30
Screen Weatherstrip . . . 30
Screen Catch . . . 30
Vintage Screen Latches . . . 31
Screen Hardware package . . . 31
Screen Strike . . . 31
Integrated Rolscreen . . . 32

**Fixed Units**

Brace Clips / Strikes . . . 33
Sill Stop Extension . . . 33
Frame Weatherstrip . . . 33
Fixed Sash . . . 33
Frame Stops . . . 34
Hinge Kit . . . 34
Large Fixed Safety Strap . . . 34

**Muntins**

Muntin Clips . . . 35
Muntin Tacks . . . 35


Rev. 06/08/2026

# Pella® Reserve™ and Architect Series® Single/Double-Hung

index




**Pella® Reserve™**
**Pella® Architect Series® Reserve™**
**Pella® Architect Series®**

**Double-Hung**
**SE / LX (Model 5)**
**02/2011 - Current**

## Pella® Reserve™ and Architect Series® Single/Double-Hung

index




**Pella® Architect Series® Double-Hung - SE**
**2005 - 01/2011**




**Pella® Architect Series® Double-Hung - LX**
**2005 - 01/2011**

## Pella® Reserve™ and Architect Series® Single/Double-Hung


index




**Pella® Architect Series® Double-Hung**
**1995 - 2004**




**Pella® Architect Series® Double-Hung**
**1993 - 1994**

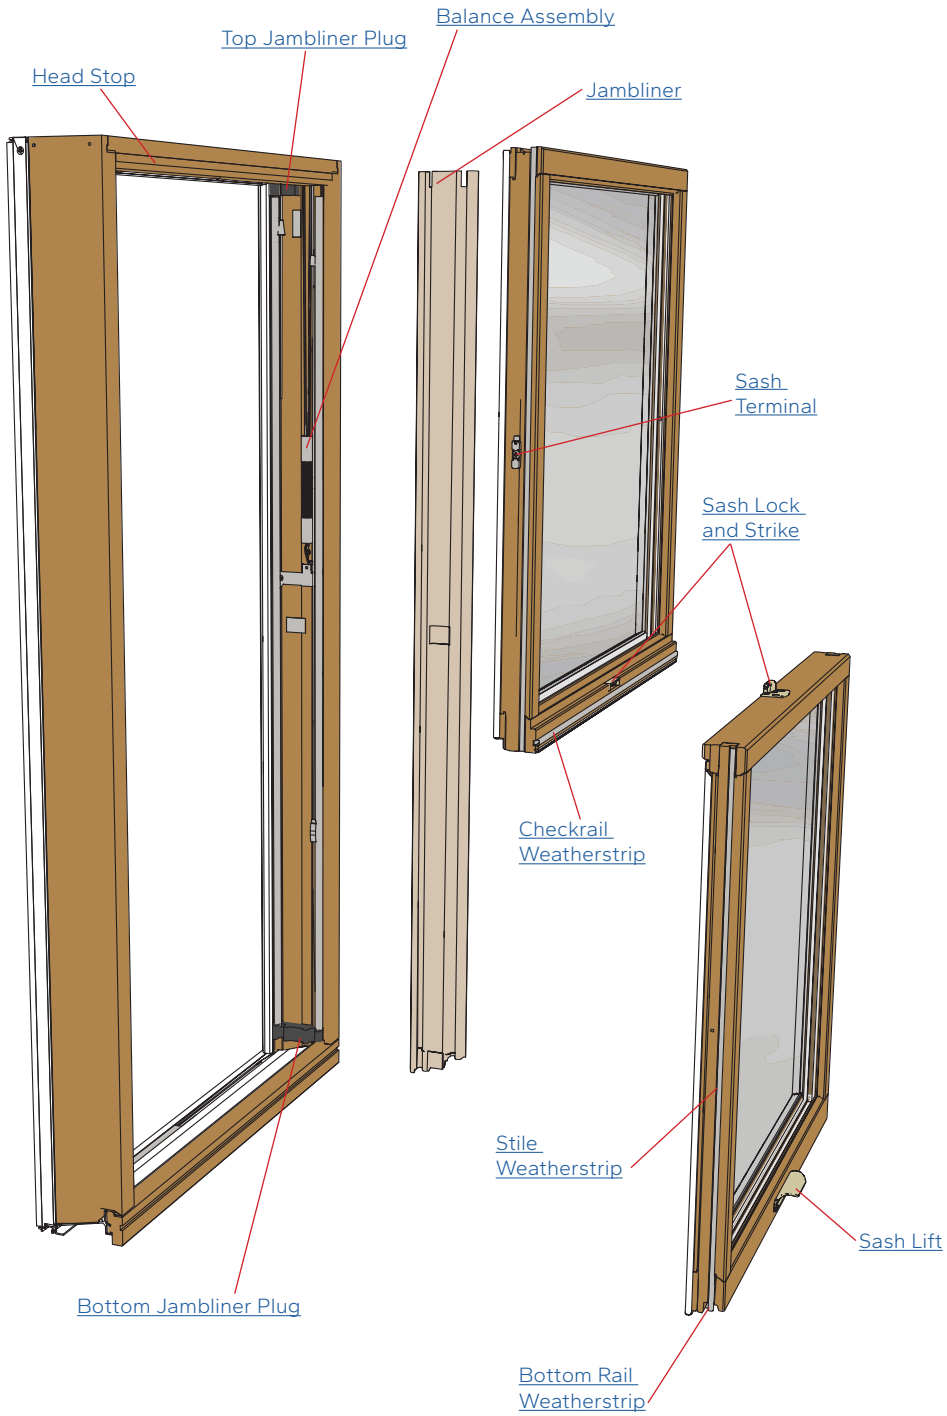



**Pella® Architect Series® Double-Hung**
**1991 - 1992**
**Wood Exterior launched in 1990, Clad exterior launched in 1991**




**Pella® Architect Series® Monumental-Hung**
**HurricaneShield® Impact Resistant**
**07/2015 - Current**


## Pella® Reserve™ and Architect Series® Single/Double-Hung

index

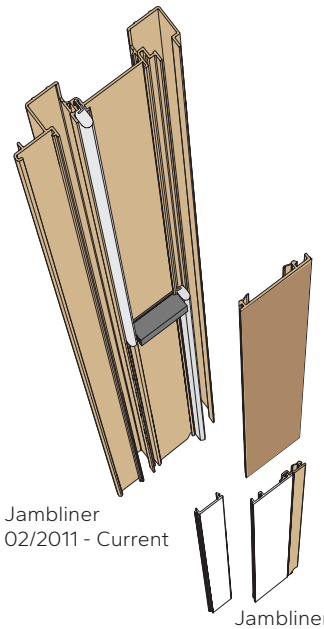


Jambliner
02/2011 - Current


Jambliner
Inserts (LX)

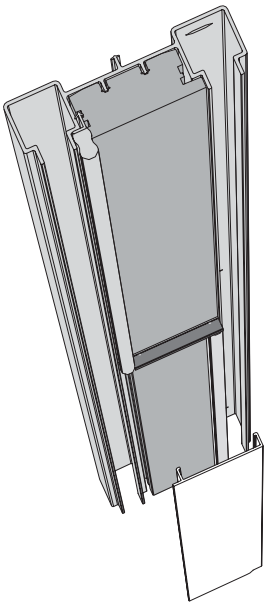


LX Jambliner
2005 - 01/2011
(Replaces earlier
design)

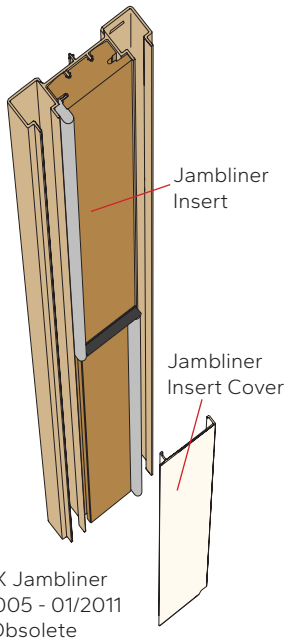



LX Jambliner
2005 - 01/2011
(Obsolete
Original Design)

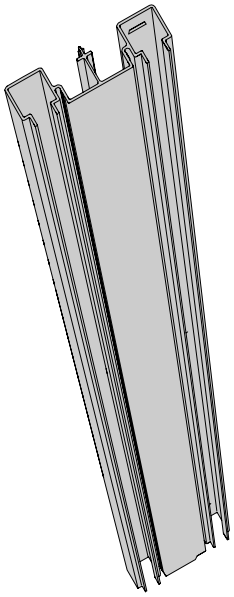


SE Jambliner
2005 - 01/2011

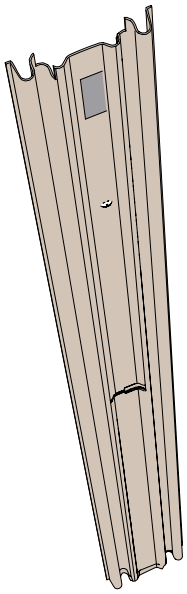

Jambliner
1991 - 2005

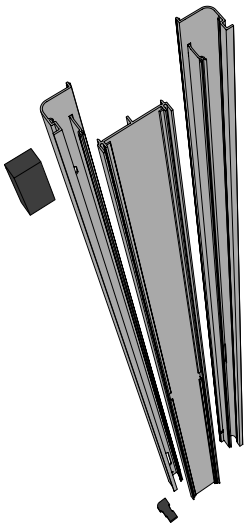

Model 6 - Monumental
Hung, HIG Jambliner

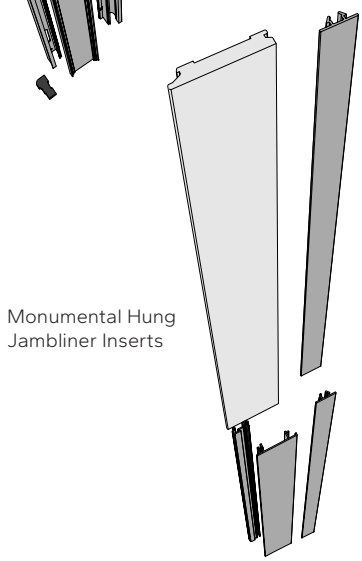


Monumental Hung
Jambliner Inserts


| | PQM location | Reqd. Info |
|---|---|---|
| Replacement Jambliner Assembly<br>Jambliner Assembly with Insert (LX only)<br><br>LX: 02/2011 - Current; 01/2005 - 01/2011<br>SE: 02/2011 - Current; 02/2005 - 01/2011; 01/1995 - 01/2005; 01/1993 -12/1994 | Frame Service Item | Frame width, Frame Height, Venting Height, finish/color |
| Monumental Hung Jambliner<br><br>07/2015 - Current (Model 6)<br>11/1999 - 06/2015<br>01/1997 - 10/1999 - No Longer Available | Frame Service Item | Frame width, Frame Height, Venting Height, finish/color |
| Monumental Hung Jambliner Inserts (Model 6)<br><br>07/2015 - Current | Frame Service Items | Frame Width, Frame Height, Venting Height, finish/color |
| Replacement Jambliner Inserts Package (LX only)<br>Includes 2 upper jamb inserts, 2 plastic Lower Jamb Inserts (1 LH, 1 RH), 2 metal Lower Jamb Inserts (1 LH, 1 RH).<br><br>02/2011 - Current | Frame Service Item, Service Type: Jambliner | Frame width, Frame Height, Venting Height, finish/color |
| Jambliner Insert Cover Only - LX Unit - LH/RH<br><br>01/2005 - 01/2011 | Frame Service Item, Service Type: Jambliner | Frame width, Frame Height, Venting Height, finish/color |

## Pella® Reserve™ and Architect Series® Single/Double-Hung


index

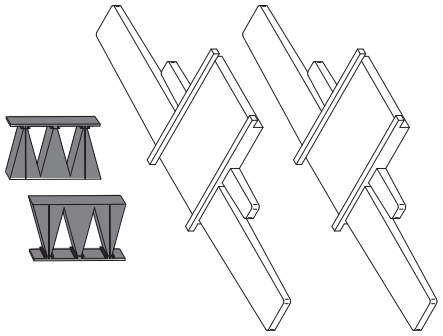


| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
| Insert connector and jamb mohair (Includes 2 of each) (for HIG units)<br><br>01/2009 - 07/2015 | 00MR0000 | Weatherstrip/ Gasket/Mohair | |

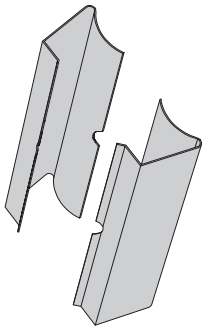

| | | | |
|---|---|---|---|
| DH JAMB BOOSTER SPRING, (Pkg 10)<br><br>1991 - 12/2004 | 0FAG0000 | Frame Parts | Jamb Adjusters |

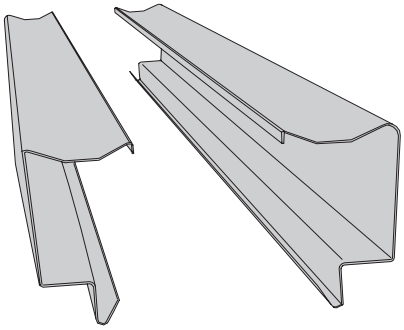


| | | | |
|---|---|---|---|
| TD (DH) Jamb Pressure Spring - 120"<br><br>1991 - 12/2004 | 052C0000 | Frame Parts | Jamb Adjusters |

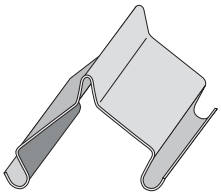

| | | | |
|---|---|---|---|
| DH CHCKRAIL PRES Spring 609 (5)<br><br>2009 - 06/2020 | No Longer Available (008H0000) | | |




| | | | |
|---|---|---|---|
| Pkg 1 Adjustable Sill Adapter (Precision Fit)<br><br>2000 - Current | 09DZ0001 | Frame Parts | Sill Assembly/ Accessories |

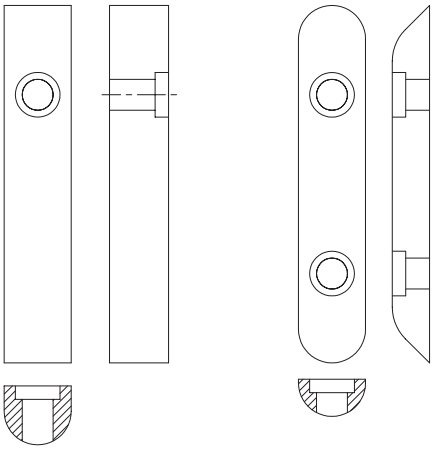

| | | | |
|---|---|---|---|
| AS/DS DH Char Jambliner Enhancement kit<br>Includes 4 of each plug with installation screws and instructions.<br><br>1991 - 2008 | 00B60000 | Frame Parts | Jamb/Dust Plugs |

## Pella® Reserve™ and Architect Series® Single/Double-Hung

index

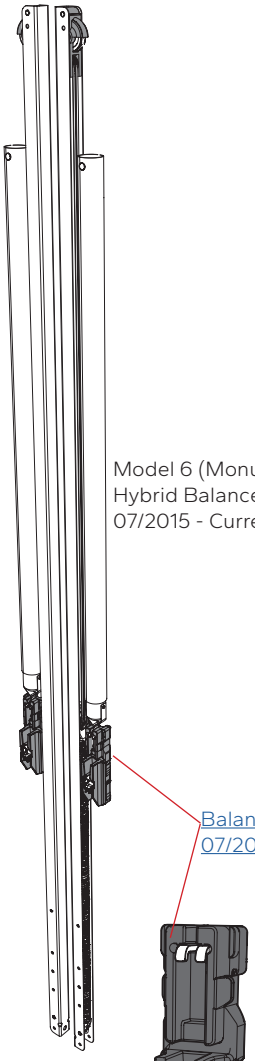

Model 6 (Monumental/HIG Hybrid Balance Assembly, 07/2015 - Current

Balance Shoe 07/2015 - Current








Balance Shoe 02/2011 - Current Model 4-5



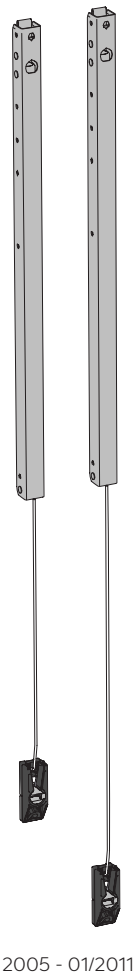

02/2011 - Current Model 4-5





2005 - 01/2011

| | | PQM location | Reqd. Info |
|---|---|---|---|
| Balance Assembly | | Frame Service Items | Frame Width, Frame Height, Glazing |
| LX<br>02/2011 - Current<br>2005 - 01/2011 | SE<br>02/2011 - Current<br>02/2005 - 01/2011<br>02/2002 - 01/2005<br>01/1993 - 01/2002<br>01/1990 -12/1992 (No Longer Available) | | |
| HIG - Balance Assembly<br><br>07/2015 - Current<br>01/2010 - 06/2015<br>01/2005 - 12/2009 | | Frame Service Items | Frame Width, Frame Height, Glazing |
| Monumental Hung - Balance Assembly<br><br>07/2015 - Current<br>11/1999 - 06/2015<br>01/1997 - 10/1999 | | Frame Service Items | Frame Width, Frame Height, Glazing |

| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
| AS DH Model 5 Replacement Balance Shoe Package<br>(Pkg 4)<br><br>02/2011 - Current | 01X20000 | Balances | |
| ASDH3, ASDH5, ASDH6 Single Hung Screw<br>(Qty. 50)<br><br>2005 - Current | 0DNQ0000 | Screws/Plugs/ Caps/Misc | |




## Pella® Reserve™ and Architect Series® Single/Double-Hung

index
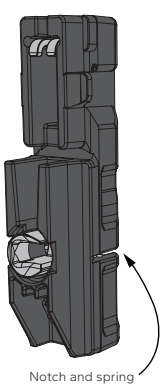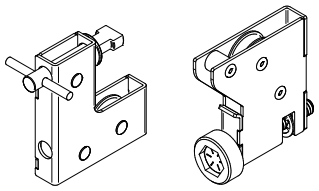
| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
|  AS HIG DH & MH, Balance Catch, July 2015 - Current (Qty. 4)<br><br>07/2015 - Current | 207Q0000 | Balances | |
|    Non-Locking Balance Shoe<br><br>AS HIG DH & MH, Non Lock Balance Shoe, July 2015 - Cur, (Qty. 2)<br><br>07/2015 - Current | 207V0000 | Balances | |
| AS HIG DH & MH, Locking Balance Shoe, July 2015 - Cur, (Qty. 2)<br><br>07/2015 - Current | 207W0000 | Balances | |
|   <br><br>AS Model 4-5 Balance Shoe<br><br>Extension comes attached on all replacement balance shoes. Extension required on lower sash for hung units with Integrated Rolscreen retractable screen and on units without Integrated Rolscreen it may be removed.<br><br>07/2015 - Current | 01X20000 | Balances | |
|  AS DH Balance Setter Service Tool<br><br>07/2015 - Current | 208C0000 | Balances | |
|  AS Impact & Monumental Hung Upgraded Balance Adjustment Tool<br><br>07/2015 - Current | 04ZL0000 | Balances | |


## Pella® Reserve™ and Architect Series® Single/Double-Hung

index

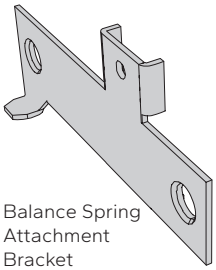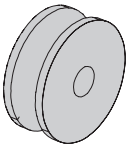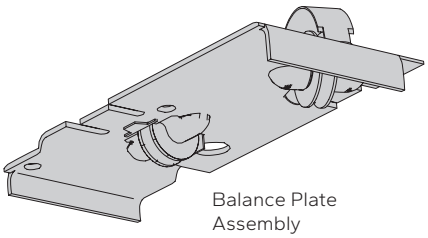
| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
|  Balance Spring Attachment Bracket<br>DH BAL Spring Attach BKT (2)<br>1981 - 1992 | No Longer Available | | |
| <br>DH Balance Pulley (10)<br>1981 - 1992 | No Longer Available | | |
|  Balance Plate Assembly<br>DH Balance Plate Assy. (1 assembly)<br>1981 - 1992 | No Longer Available | | |
| <br>DH Balance Cord, roll 3000 ft<br>1981 - 1992 | No Longer Available | | |
| <br>Upper Balance Spring Stop<br>1981 - 1992 | No Longer Available | | |
| <br>DH Cord Air Stop<br>1981 - 1992 | No Longer Available | | |

## Pella® Reserve™ and Architect Series® Single/Double-Hung


index




02/2011 - Current

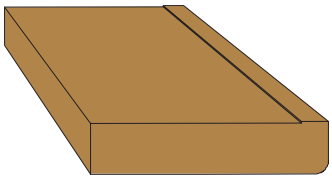


2005 - 01/2011

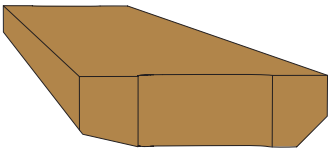


1993 - 1994

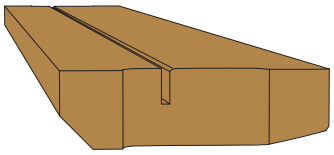


1991 - 1992

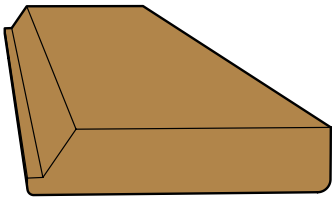


(Model 6) 07/2015 - Current

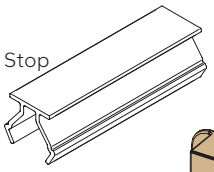


(Model 6) Sash Stop

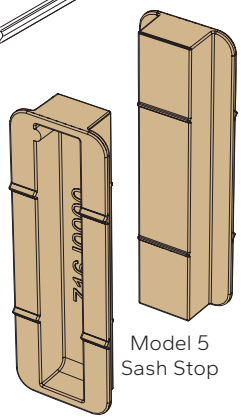



Model 5
Sash Stop



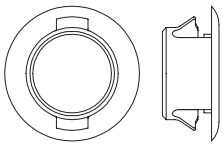


Jamb Jack Cover

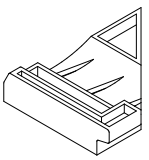



Screw
Cover

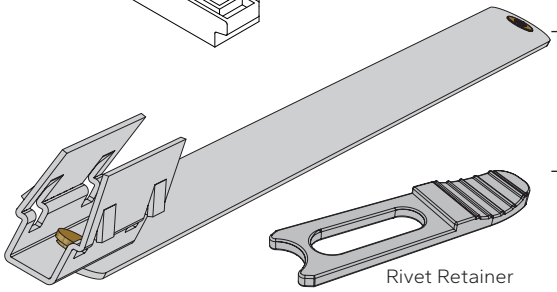


Rivet Retainer

| | PQM location | Reqd. Info |
|---|---|---|
| Frame Head Stop (Qty. 1)<br>LX: 02/2011 - Cur; 2005 - 01/2011<br>SE: 02/2011 - Cur; 02/2005 - 01/2011; Pre 01/2005 | Frame Service Item | Frame Width, Finish |
| Model 6 (Monumental/HIG)<br>07/2015 - Current | Frame Service Item | Frame Width, Finish |


| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
| AS HIG DH & MH, Sash Stop, July 2015 - Current, (Qty. 10)<br>07/2015 - Current | 207Z0000 | Sash/Panel Parts | Sash Stops/ Sash Straps |
| AS DH Model 5 Sash Stop (10)<br>02/2011 - Current | 01V20000 | Sash/Panel Parts | Sash Stops/ Sash Straps |
| ASDH3 Curve Top Head Stop Screw (Qty. 10)<br>#8 x 1-1/4" Phillips oval head screws<br>2005 - 01/2011 | No Longer Available | | |
| Pkg 10 Slotted Threaded Rod<br>Pkg 10 (Precision Fit Jamb Adjustment Screw/Jamb Jack)<br>1/4" x 20 x 1"<br>1995 - 12/2004 | No Longer Available | | |
| 2 Jamb Jack Cover Installation Pkg Includes 6 Jamb Jack Covers, 4 - #8 x 2-1/2" screws<br>—Charcoal<br>—Gray<br>1995 - 2005 | <br>No Longer Available<br>0CAH0001 | Screws/Plugs/ Caps/Misc | |
| Jamb Jack Covers (Pkg 100)<br>Gray Covers<br>1995 - 2005 | 090B0000 | Screws/Plugs/ Caps/Misc | |
| Jamb Jack Covers (Charcoal) (Pkg 100)<br>1995 - 2005 | No Longer Available (090B) | | |
| AS DH Screw Cover, Model 3 & 4 (HIG corners)<br>01/2005 - 07/2015 | 01ZZ0000 | Screws/Plugs/ Caps/Misc | |
| ASDH3 Steady Tilt Pkg<br>—9"<br>—14"<br>01/2005 - 01/2011 | <br>0DBN0009<br>No Longer Available | Sash/Panel Parts | Tilt Latches/ Pins |
| ASDH3 Steady Tilt Rivet Retainer (Qty. 10)<br>01/2005 - 01/2011 | 0DS70000 | Sash/Panel Parts | Tilt Latches/ Pins |

## Pella® Reserve™ and Architect Series® Single/Double-Hung


index

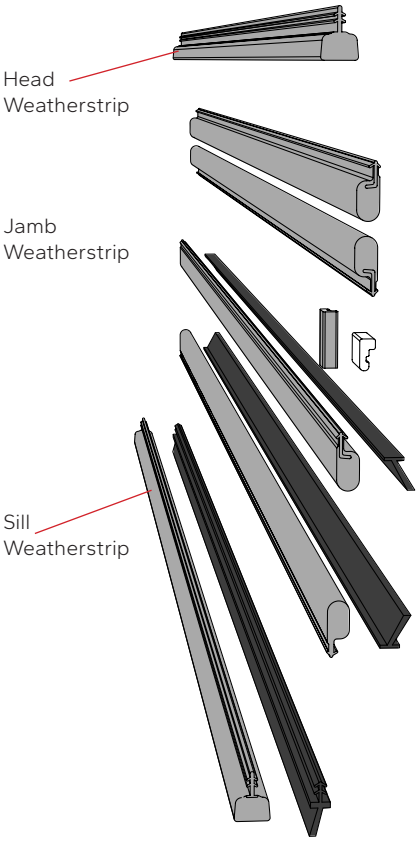



| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
| AS HIG DH & MH, Weatherstrip, July 2015 - Current<br>Includes: Head weatherstrip, Upper and lower jamb weatherstrip, weatherstrip groove filler, Sill weatherstrip, Installation instructions.<br><br>07/2015 - Current | 207M0000 | Weatherstrip/ Gasket/Mohair | |

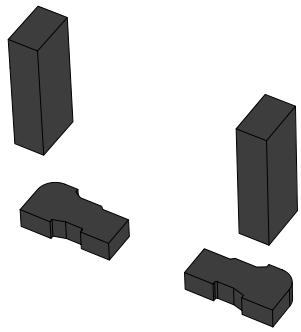

| | | | |
|---|---|---|---|
| AS HIG DH & MH, Foam Plug Kit, July 2015 - Cur-Cur, (2 Sets 2)<br>Includes 2 Jambliner bottom plugs and 2 balance plugs.<br><br>07/2015 - Current | 207Y0000 | Screws/Plugs/ Caps/Misc | |

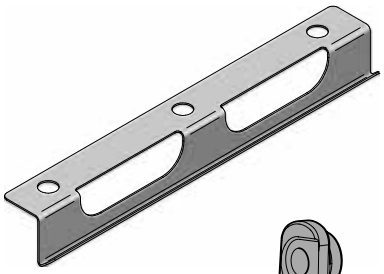


| | | | |
|---|---|---|---|
| AS HIG DH & Monumental DH, SH Clip, July 2015 - Cur, (Qty. 2)<br><br>07/2015 - Current | 207T0000 | Frame Parts | Windload Brace Clips |

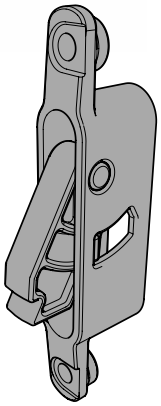



| | | | |
|---|---|---|---|
| AS HIG DH & Mon DH, Structural Bolt, July 2015 - Cur, (Qty. 2)<br><br>07/2015 - Current | 207U0000 | Frame Parts | Windload Brace Clips |

## Pella® Reserve™ and Architect Series® Single/Double-Hung

index

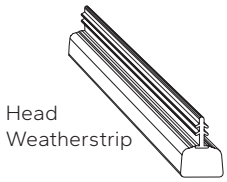

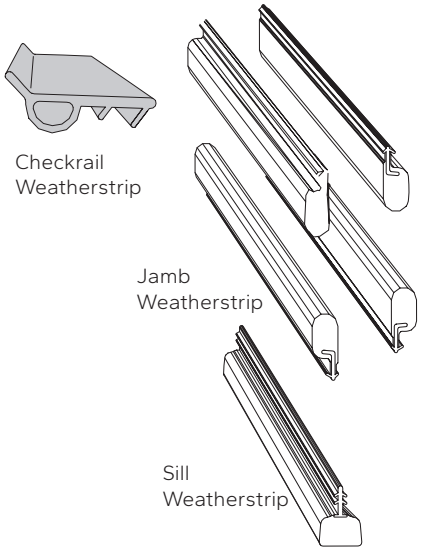


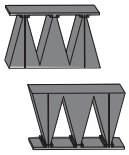

| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
| AS Model 5 Weatherstrip (Qty. for 1 Unit)<br>Includes Head, upper and lower jamb, Jambliner mohair pads, checkrail and sill weatherstrip.<br><br>02/2011 - Current | 01PX0000 | Weatherstrip/ Gasket/Mohair | |
| AS DH HIG (Model 4) Weatherstrip Package<br>Includes Head, upper and lower jamb, checkrail and sill weatherstrip.<br><br>01/2009 - 07/2015 | 00MU0000 | Weatherstrip/ Gasket/Mohair | |
| AS Model 5 Jambliner Mohair (50)<br><br>02/2011 - Current | 01PY0050 | Weatherstrip/ Gasket/Mohair | |
| Checkrail/Stile/Head W/S —(box 20)<br><br>1999 - 2009 | 0BDZ0000 | Weatherstrip/ Gasket/Mohair | |


## Pella® Reserve™ and Architect Series® Single/Double-Hung

index

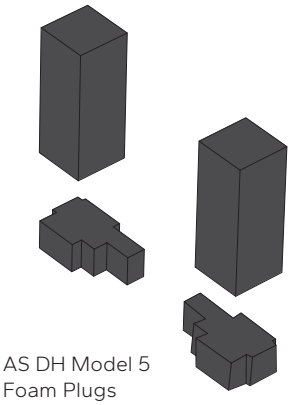

AS DH Model 5 Foam Plugs


| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
| AS Std DH Foam Plugs<br>Includes 2 Jamb plugs, 2 balance plugs.<br><br>02/2011 - Current | 01TF0000 | Frame Parts | Jamb/Dust Plugs |

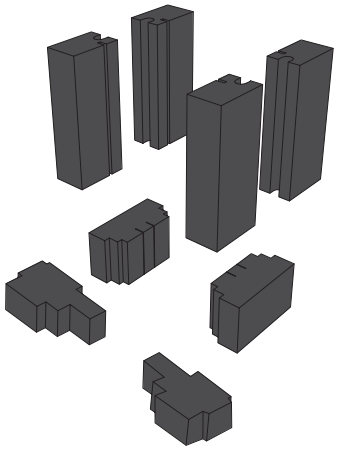



| | | | |
|---|---|---|---|
| Upper and Lower Jamb Plugs (HIG)<br>Includes 4 Upper Jamb Plugs, 2 Lower Jamb Plugs and 2 Bottom Jamb Plugs.<br><br>01/2009 - 07/2015 | 00ML0000<br><br>Upper 502z<br>Lower 502w<br>Plug 733x | Frame Parts | Jamb/Dust Plugs |


## Pella® Reserve™ and Architect Series® Single/Double-Hung


index

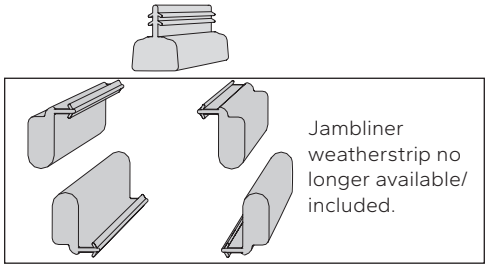


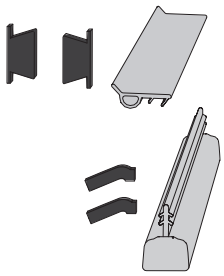


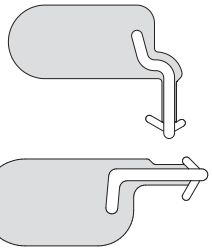
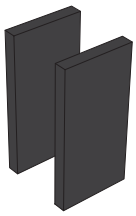


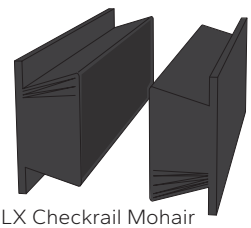
LX Checkrail Mohair

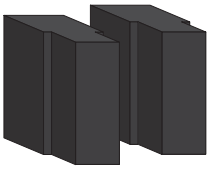

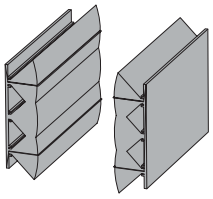
SE Checkrail Mohair

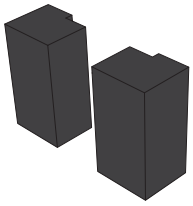
SE Jambliner Plug


LX Jambliner Plug




| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
| ASDH3 LX Weatherstrip (Qty. for 1 Unit)<br>Includes Head, checkrail, checkrail mohair pads, Jambliner mohair pads, and sill weatherstrip.<br><br>01/2005 - 01/2011 | 0D7K0000 | Weatherstrip/ Gasket/Mohair | |
| ASDH3 SE Complete Unit Weatherstrip (Qty. for 1 Unit)<br>Includes Head, upper and lower jamb, Jambliner mohair pads, and sill weatherstrip.<br><br>01/2005 - 01/2011 | 0D7L0000 | Weatherstrip/ Gasket/Mohair | |
| ASDH3 LX Jambliner Weatherstrip (Qty. 15 pc each 7')<br><br>01/2005 - 01/2011 | No Longer Available (0DBP) | | |
| Jamb Weatherstrip 100' - SE Model 3<br><br>01/2005 - 01/2011 | 0DBQ0000 | Weatherstrip/ Gasket/Mohair | |
| ASDH3 Checkrail Weatherstrip Pkg (50 ft)<br><br>01/2005 - 01/2011 | 0DTM0050 | Weatherstrip/ Gasket/Mohair | |
| ASDH3 LX Checkrail Mohair Pkg (Qty. 50)<br><br>01/2005 - 01/2011 | 0D7M0050 | Weatherstrip/ Gasket/Mohair | |
| ASDH3 Balance Groove Water Plug (Qty. 10)<br><br>01/2005 - 01/2011 | 0DRZ0010 | Frame Parts | Jamb/Dust Plug |
| ASDH3 SE Checkrail Mohair Pkg (Pkg 50)<br><br>01/2005 - 01/2011 | 0DTH0050 | Weatherstrip/ Gasket/Mohair | |
| ASDH3 SE Jambliner Water Plug (Pkg 20)<br><br>01/2005 - 01/2011 | 0DTK0020 | Frame Parts | Jamb/Dust Plugs |
| ASDH3 LX Jambliner Water Plug (Pkg 20)<br><br>01/2005 - 01/2011 | 0DTL0020 | Frame Parts | Jamb/Dust Plugs |
| ASDH3 Glazing Tape Chiclets (Qty. 24)<br><br>01/2005 - 01/2011 | No Longer Available | | |
| AS DH Sash Allowance Kit, Thick (Jan 2005 - Current)<br>1/2" x 1/4", 1 - 36 yard roll<br><br>01/2005 - Current | 01PQ0001 | Weatherstrip/ Gasket/Mohair | |
| AS DH Sash Allowance Kit, Thin (Jan 2005 - Current)<br>7/32" x 1/4", 1- 36 yard roll<br><br>01/2005 - Current | 01PQ0000 | Weatherstrip/ Gasket/Mohair | |


## Pella® Reserve™ and Architect Series® Single/Double-Hung


index




TD/WT
Mohair Pad

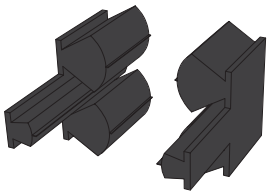


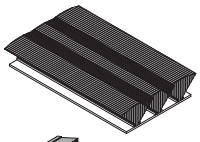

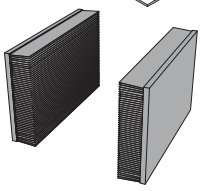


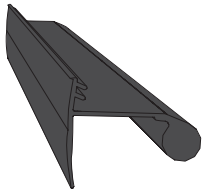

Bottom Rail Weatherstrip
2000 - 12/2004




1991 - 07/2015
(discontinued)

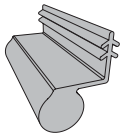

1991 - 07/2015
(replacement)


Bottom Jambliner Foam Plug

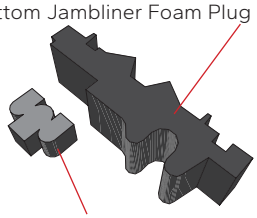

Terminal Groove Plug




Jambliner Plugs (Top)

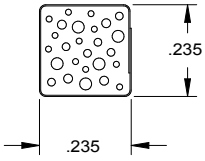



Checkrail Weatherstrip
1991 - 2004



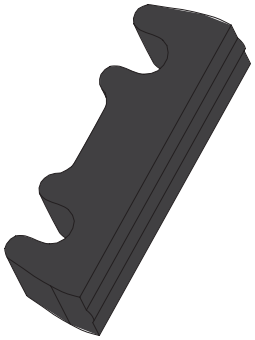

Jambliner Plugs Bottom
1981 - 04/1993



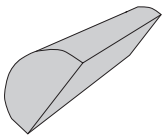

| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
| Self Adhesive Mohair Pads (Pkg 20)<br><br>1993 - 12/2004 | 060K0000 | Weatherstrip/ Gasket/Mohair | |
| TD/WT Mohair Pads (20)<br><br>1993 - 12/2004 | 0CN80001 | Weatherstrip/ Gasket/Mohair | |
| Jamb Mohair (Pkg 50)<br><br>1993 - 12/2004 | 00LF0000 | Weatherstrip/ Gasket/Mohair | |
| DH Check Rail Pad TD Check Rail Pad Pkg (20)<br><br>1993 - 12/2004 | 06D30001 | Weatherstrip/ Gasket/Mohair | |
| Bot Rail Wstrp 43" - DSw/dgp 00-05 & PL Current<br><br>2000 - 12/2004 | 052H0000 | Weatherstrip/ Gasket/Mohair | |
| BOT Rail Weatherstrip Pkg 20 - pre 1/10/00<br><br>1991 - 07/2015<br>(Replaces earlier design) | 09H80001 | Weatherstrip/ Gasket/Mohair | |
| Terminal Plugs (2) Jambliner Foam Plugs(2)<br><br>1991 - 12/2004 | 0CQN0004 | Frame Parts | Jamb/Dust Plug |
| Pkg 2 Jambliner Plugs Bottom<br><br>1991 - 12/2004 | 0BEW0001 | Frame Parts | Jamb/Dust Plug |
| Pkg 2 Jambliner Plugs (Top)<br><br>1991 - 12/2004 | 0BET0002 | Frame Parts | Jamb/Dust Plug |
| CKRail Weatherstrip Pkg 10 OBS<br><br>1991 - 12/2004 | 0DM00002<br>No Longer Available | | |
| Pkg 10 DH WSTRP Top/Bot<br><br>1991 - 1992 | No Longer Available (0D10) | | |
| Pkg 2 Jambliner Plugs Head<br><br>05/1993 - 11/1997 | No Longer Available | | |
| Pkg 10 DH JMBLINER Plug BOT<br><br>1981 - 04/1993 | 0B550000 | Frame Parts | Jamb/Dust Plug |
| TD Stile WSTRIP, Obs (10)<br><br>1981 - 1992 | No Longer Available (06C0) | | |

## Pella® Reserve™ and Architect Series® Single/Double-Hung

index



Upper Sash (LX/SE)
02/2011 - Current




Lower Sash (LX/SE)
02/2011 - Current

**NOTE:** When ordering a replacement AS Reserve Upper Sash for 02/2017 - 07/2018 vintage - the sash will be provided as the 08/2018 - Current vintage. A 08/2018 - Current Upper Sash Wash Lock (05CL0000) must also be ordered.

Model 1 sash 1990 - 1994 no longer available.








| | PQM location | Reqd. Info |
|---|---|---|
| Sash Assembly<br>(Qty. 1)<br><br>Clad<br>02/2011 - Current<br>2005 - 2011<br>1995 - 2005<br>1990 - 1994<br><br>Wood<br>02/2011 - Current<br>2005 - 2011<br>1995 - 2005<br>1993 - 1994<br>1991 - 1992 | Sash/Panel Service Items<br><br>Model 1 sash 1990 - 1994 no longer available | Sash Style, Frame Width, Frame Height, Glazing, Exterior Material type and Color, Interior Finish |
| Monumental Sash Assembly<br><br>07/2015 - Current<br>10/2013 - 06/2015<br>11/1999 - 09/2013<br>01/1997 - 10/1999 | Sash/Panel Service Items | Sash Style, Frame Width, Frame Height, Glazing, Exterior Material type and Color, Interior Finish |
| HIG Sash Assembly<br><br>07/2015 - Current<br>01/2009 - 06/2015<br>01/2005 - 12/2008 | Sash/Panel Service Items | Sash Style, Frame Width, Frame Height, Glazing, Exterior Cladding Color |
| Insulating Glass<br><br>(Vintage units only)<br>1990 - 1994<br>1995 - 2005 | Sash/Panel Service Items | Frame Width, Frame Height, Sash Style, Glazing, |
| Sash Cover (Cladding) SE or LX<br>Not compatible with units that have ILT or SDL Grilles<br>(Qty. 1 set)<br><br>2/2011 - 03/2019<br>2005 - 2011<br>1995 - 2005<br>1990 - 1994 | No Longer Available | |
| Impact Sash Cladding<br><br>07/2015 - Current<br>01/2009 - 06/2015<br>01/2005 - 12/2008 | | Sash Style, Frame Width, Frame Height, Glazing, Exterior Cladding Color |
| Monumental Hung Interlocker<br><br>07/2015 - Current<br>11/1999 - 06/2015<br>01/1997 - 10/1999 | Sash/Panel Service Items | Sash Style, Frame Width, Frame Height, Glazing, Exterior Cladding Color |
| Monumental Hung Cladding Set<br><br>07/2015 - Current<br>11/1999 - 06/2015<br>01/1997 - 10/1999 | Sash/Panel Service Items | Sash Style, Frame Width, Frame Height, Glazing, Exterior Cladding Color |

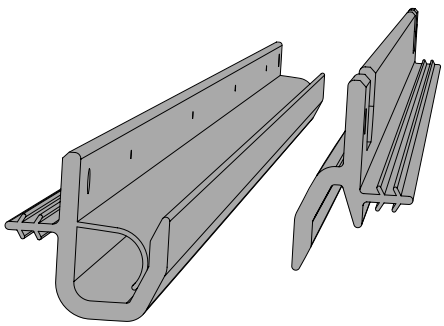

Monumental Hung Interlocker
07/2015 - Current






## Pella® Reserve™ and Architect Series® Single/Double-Hung

index
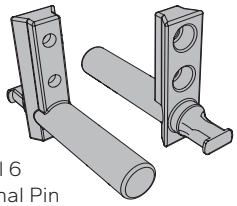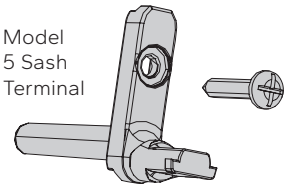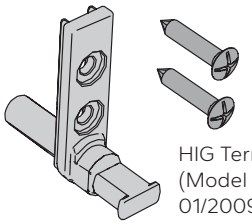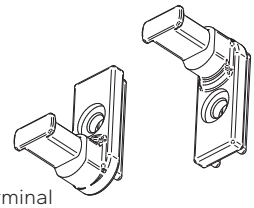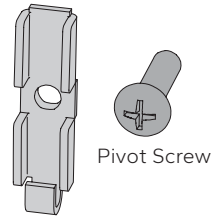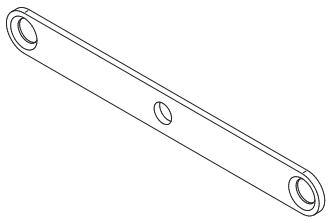
| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
|  Model 6 Terminal Pin<br>AS HIG DH & MH, Terminal Pin, July 2015 - Current, (Qty. 4)<br>(Model 6) Includes 4 pins and 9 screws.<br><br>07/2015 - Current | 207N0000 | Sash/Panel Parts | Terminal Pins |
|  Model 5 Sash Terminal<br>AS Std DH Sash Terminals, (Jan 2005 - Current) (Model 5)<br>–Qty. 2<br>–Qty. 50<br><br>02/2011 - Current | <br>01PU0001<br>01PU0000 | Sash/Panel Parts | Terminal Pins |
|  HIG Terminal Pin (Model 5) 01/2009 - 07/2015<br>AS DH HIG Terminal Pin, Model 5, (Qty. 50)<br>Jan 2009 - July 2015<br><br>01/2009 - 07/2015 | 00LK0000 | Sash/Panel Parts | Terminal Pins |
|  Model 3 Terminal 03/2005 - 01/2011<br>ASDH3 Sash Terminal and Screws<br><br>03/2005 - 2011<br>Replace with Model 5 Sash terminals, see replacement instructions for installation details. | No Longer Available | | |
|  TD Cord Terminal Pivot Screw<br>TD (DH Balance) Cord Terminal Assy. (50)<br>Screws are not included<br><br>1995 - 02/2005 | 06K50000 | Sash/Panel Parts | Terminal Pins |
| (DH) Pivot Screw<br>Qty. 20<br><br>1995 - 02/2005 | 0F230003 | Screws/Plugs/ Caps/Misc | |
| <br>Sash Terminal AS/DS (2002)<br>PKG 20<br><br>1995 - 02/2005 | 0T050000 | Sash/Panel Parts | Terminal Pins |
| <br>Pivot Plate & Pivot Screws CD/MD<br><br>1970 - Current | No Longer Available | | |











## Pella® Reserve™ and Architect Series® Single/Double-Hung

index
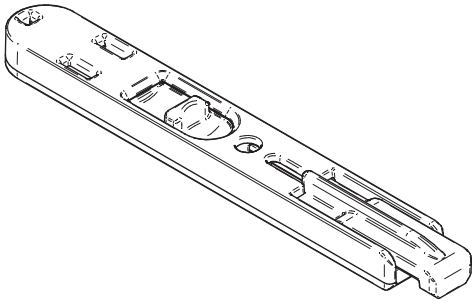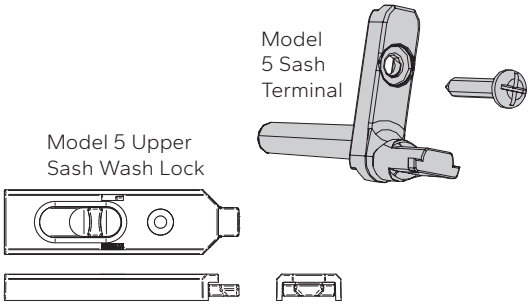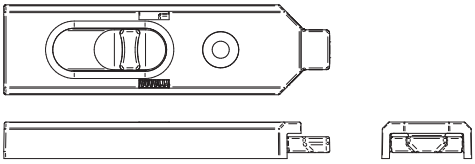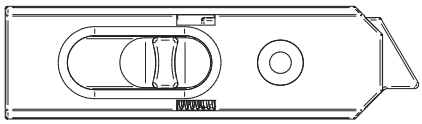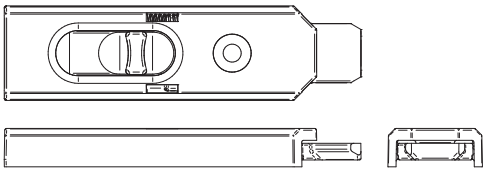
| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
|  AS Standard DH Upper Sash Wash Locks (August 2018 - Current) Pkg includes 1 Left, 1 Right and installation screws<br><br>August 2018 - Current | 05CL0000 | Window Hardware | Wash Lock |
|  Model 5 Sash Terminal<br>Model 5 Upper Sash Wash Lock<br>Upper Sash Hardware Package (Model 5) Includes 2 Sash Terminals, 2 Upper Wash Locks, installation screws and instructions<br><br>02/2011 - Jul 2018 | No Longer Available | | |
|  Model 5 Upper Sash Wash Lock<br>AS Std DH Upper Sash Wash Lock, (Feb 2011 - Jul 2018) Pkg Includes 1 Left, 1 Right and installation screws<br><br>02/2011 - Jul 2018 | 01PT0000 | Window Hardware | Wash Lock |
|  ASDH3 Upper Wash Lock (Qty. 1 LH, 1 RH) Includes installation screws<br><br>01/2005 - 2011 | 0CSJ0000 | Window Hardware | Wash Lock |
|  Model 6 Upper Washlock<br>AS HIG DH & MH, Upper Washlock, July 2015 - Cur, (1 Set of 2)<br><br>07/2015 - Current | 207P0000 | Window Hardware | Wash Lock |


## Pella® Reserve™ and Architect Series® Single/Double-Hung

index
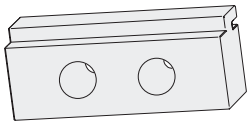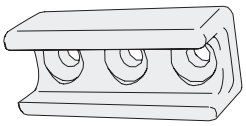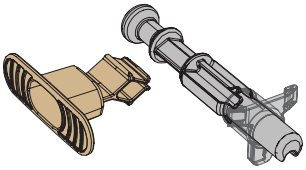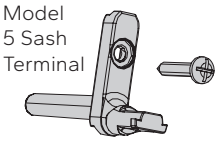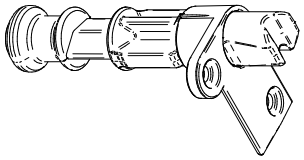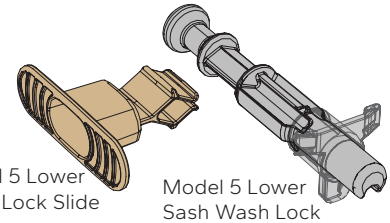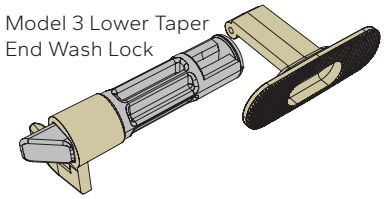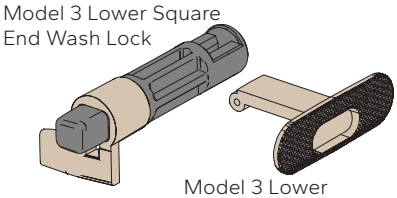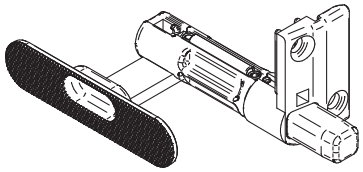
| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
|  AS DH HIG Lower Jamb Block, Jan 2009 - July 2015 Includes 2 blocks and installation screws<br><br>2009 - 07/2015 | 00MQ0000 | Frame Parts | Anti-Lift Clips/ Blocks |
|  AS DH HIG Wash Lock Strike, Jan 2009 - July 2015 Includes 2 strikes and installation screws<br><br>2009 - 07/2015 | 00MP0000 | Window Hardware | Wash Lock |
|     Lower Sash Hardware Package (Model 5) Includes 2 Sash Terminals, 2 Lower Wash Locks, 2 Lower Wash Lock Slides, installation screws and instructions<br><br>02/2011 - Current | 01V30001 | Window Hardware | Lock Levers/ Lock Handles/ Sets |
|  AS HIG DH & MH, Lower Wash Lock, July 2015 - Cur, (2 Sets of 2)<br><br>07/2015 - Current | 207S0000 | Window Hardware | Wash Lock |
|   AS Std DH Lower Sash Wash Lock, (Feb. 2011 - Current) Includes 2 Locks only, NO slides.<br><br>02/2011 - Current | 01PS0000 | Window Hardware | Wash Lock |
| AS Std DH Lower Wash Lock Slide, (Feb. 2011 - Current), Qty. 20<br><br>02/2011 - Current | 01PV0000 | Window Hardware | Wash Lock |
|   ASDH3 Lower Taper End Wash Lock (Qty. 1 LH,1 RH) Includes Slide<br><br>01/2005 - 2011 | 0CSH0000 | Window Hardware | Wash Lock |
|   ASDH3 Lower Square End Wash Lock (Qty. 1 LH,1 RH) Includes Slide<br><br>01/2005 - 2011 | 0DLW0000 | Window Hardware | Wash Lock |
| ASDH3 Lower Washlock Knurled Finger Tab (20)<br><br>01/2005 - 2011 | 0DWG0000 | Window Hardware | Wash Lock |
|  AS DH Lower Wash Lock Knurled Finger Tab, Model 3, 4, (Pkg 20)<br><br>01/2005 - 2011 | 00LL0000 | Window Hardware | Wash Lock |
|  AS DH HIG Lower Wash Lock LH/ RH, Jan 2009 - July 2015 Includes installation Screws and Finger Tabs<br><br>01/2009 - 07/2015 | 00KQ0000 | Window Hardware | Wash Lock |

## Pella® Reserve™ and Architect Series® Single/Double-Hung

index

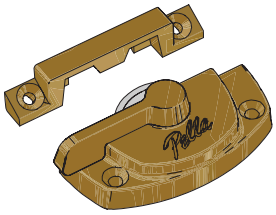


Standard Lock

| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
| AS (Model 3, 5, 6) and PL DH Cam Lock and Strike (Standard Lock and Strike) | | Window Hardware | Cam-Action Lock |
| —Brass | 0BMW0001 | | |
| —Brown | 0BMW4000 | | |
| —Champagne | 0BMW0000 | | |
| —Matte Black | 0BMWMB00 | | |
| —Oil Rubbed Bronze | 0BMWBZ01 | | |
| —Satin Brass | 0BMW0010 | | |
| —Satin Nickel | 0BMWP000 | | |
| —White | 0BMW6000 | | |
| 06/2009 - Current<br>Replaces 01/2005 - 05/2009 vintage | | | |



Spoon Lock

| | | | |
|---|---|---|---|
| AS (Model 3, 5, 6) Spoon Lock/ Strike | | Window Hardware | Spoon-Style Lock |
| —Antique Brass | No Longer Available | | |
| —Brass | 0CSM5000 | | |
| —Brown | 0CSM4000 | | |
| —Champagne | 0CSMD000 | | |
| —Distressed Bronze | 0CSMDB00 | | |
| —Distressed Nickel | 0CSMDN00 | | |
| —Matte Black | 0CSMMB00 | | |
| —Oil Rubbed Bronze | 0CSMBZ01 | | |
| —Satin Brass | 0CSMSB00 | | |
| —Satin Nickel | 0CSMP000 | | |
| —White | 0CSM6000 | | |
| 06/2009 - Current<br>Replaces 01/2005 - 05/2009 vintage | | | |

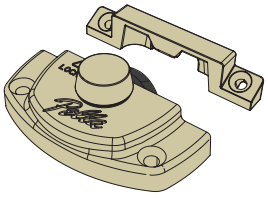


Air Conditioning Lock

| | | | |
|---|---|---|---|
| AS (Model 3, 5, 6) A/C Lock & Strike | | Window Hardware | Air Conditioner Lock |
| —Brass | 0CSR5000 | | |
| —Brown | 0CSR4000 | | |
| —Champagne | 0CSRD000 | | |
| —Matte Black | 0CSRMB00 | | |
| —Oil Rubbed Bronze | No Longer Available | | |
| —Satin Nickel | 0CSRP000 | | |
| —White | 0CSR6000 | | |
| 06/2009 - Current<br>Replaces 01/2005 - 05/2009 vintage | | | |




| | | | |
|---|---|---|---|
| DH Air Conditioning Lock Key (1) | 0E0X0000 | Window Hardware | Air Conditioner Lock |
| 2005 - Current | | | |

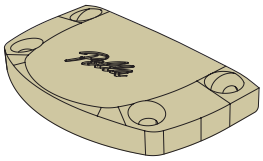

Simulated Hung Lock

| | | | |
|---|---|---|---|
| AS (Model 3, 5, 6) Simulated Lock | | Window Hardware | Simulated Lock |
| —Bright Brass | 0DJH0001 | | |
| —Brown | 0DJH4000 | | |
| —Champagne | 0DJHD000 | | |
| —Matte Black | 0DJHMB00 | | |
| —Oil Rubbed Bronze | 0DJHBZ00 | | |
| —Satin Nickel (Pewter) | 0DJHP000 | | |
| —White | 0DJH6000 | | |
| —Satin Brass (Complimentary match*) | ODJHMC00 | | |
| 06/2009 - Current<br>Replaces 01/2005 - 05/2009 vintage | | | |

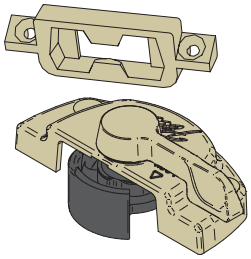


HurricaneShield Impact Resistant Lock and Strike

| | | | |
|---|---|---|---|
| AS DH HIG Lock and Strike, Jan 2009 - July 2015 | | Window Hardware | Cam-Action Lock |
| —Brass | No Longer Available | | |
| —Brown | 00LH4000 | | |
| —Champagne | 00LHD000 | | |
| —Oil Rubbed Bronze | 00LHBZ00 | | |
| —Satin Nickel | 00LHP000 | | |
| —White | 00LH6000 | | |
| 2009 - 07/2015 | | | |


* The Satin Brass for the Simulated Lock is not an exact match to the Satin Brass of other hardware pieces, but is a complementary match.

## Pella® Reserve™ and Architect Series® Single/Double-Hung


index

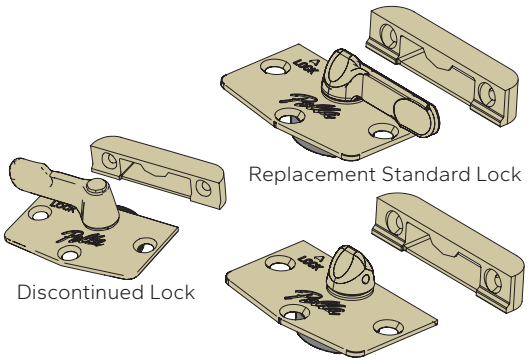



| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
| Lock & Strike Pkg<br>Qty. 1<br>Unit Width Determines number of locks needed. | | Window Hardware | Cam-Action Lock |
| —Bright Brass | 017V0001 | | |
| —A/C Champagne | No Longer Available | | |
| —Champagne | 017VD000 | | |
| —Oil Rubbed Bronze | 017VBZ00 | | |
| —Satin Nickel | 017VP000 | | |
| —White | 017V6000 | | |
| 1995 - 12/2004 | Air Conditioning Lock: No Longer Available | | |

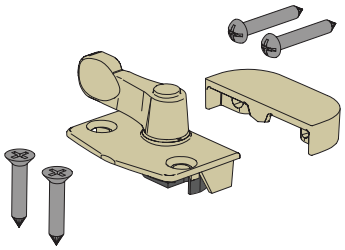

| | | | |
|---|---|---|---|
| PRE95 LK/STRK/CLIP IG PKG<br>DH Lock, Strike, Shim, and Screws - for IG Units (Pre 1995) | | Window Hardware | Cam-Action Lock |
| DGP Package | | | |
| —Brass | No Longer Available | | |
| —Champagne 1991 - 1994 | 0DLQ0001 | | |
| —Pella Gold 03/1990 - 12/1990 | 0DLQ0000 | | |
| —A/C Gold | No Longer Available | | |
| —White | No Longer Available | | |
| IG Package | | | |
| —Brass | No Longer Available | | |
| —Champagne | 0DLQ0005 | | |
| —Pella Gold | 0DLQ0004 | | |
| —White | No Longer Available | | |
| Note: Includes One Lock, One Strike, Replacement Shim and matching finish screws replaces earlier vintage locks and strikes. | | | |

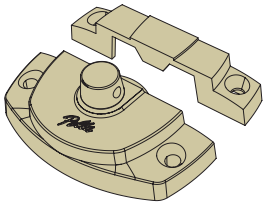






| | | | |
|---|---|---|---|
| AS Monumental and CD DH A/C Lock (Pre Aug. 2013) | | Window Hardware | Air Conditioner Lock |
| —Brass | 0B0QBR00 | | |
| —Brown | 0B0Q4000 | | |
| —Champagne | 0B0QD000 | | |
| —Oil Rubbed Bronze | 0B0QBZ00 | | |
| —Satin Nickel | 0B0QP000 | | |
| —White | 0B0Q6000 | | |
| 2005 - 2013 | | | |

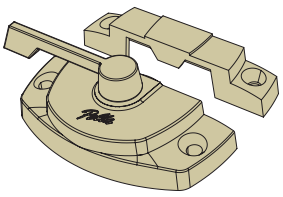

| | | | |
|---|---|---|---|
| AS Monumental and CD DH Cam Lock, (Pre Aug. 2013) | | Window Hardware | Cam-Action Lock |
| —Brass | 0BUC0000 | | |
| —Brown | 0BUA4000 | | |
| —Champagne | 0BUA0000 | | |
| —Oil Rubbed Bronze | 0BUABZ00 | | |
| —Satin Nickel | 0BUAP000 | | |
| —White | 0BUB0000 | | |
| 03/2005 - 2013 | | | |



## Pella® Reserve™ and Architect Series® Single/Double-Hung

index
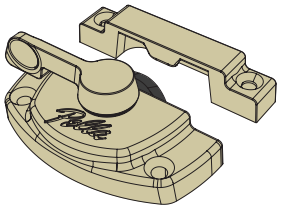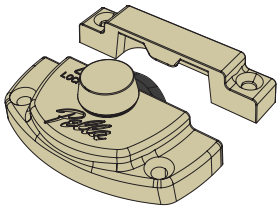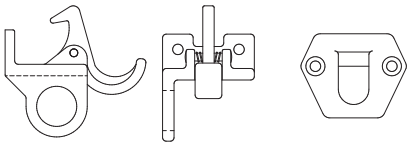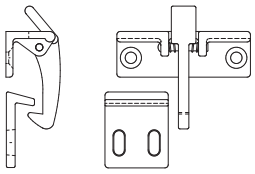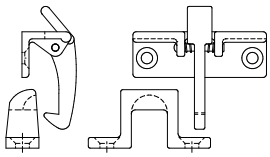
| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
|  Monumental Hung Standard Lock | | | |
| Monumental Hung Lock/Strike (2013 - Current) | | Window Hardware | Cam-Action Lock |
| —Brass | 03VQBR00 | | |
| —Brown | 03VQ4000 | | |
| —Champagne | 03VQD000 | | |
| —Oil Rubbed Bronze | 03VQBZ00 | | |
| —Satin Nickel | 03VQP000 | | |
| —White | 03VQ6000 | | |
| 08/2013 - 07/2015 | | | |
|  Monumental Hung Air Conditioning Lock | | | |
| Monumental Hung AC Lock/Strike (2013 - Current) | | Window Hardware | Air Conditioner Lock |
| —Brass | 03VPBR00 | | |
| —Brown | 03VP4000 | | |
| —Champagne | 03VPD000 | | |
| —Oil Rubbed Bronze | 03VPBZ00 | | |
| —Satin Nickel | 03VPP000 | | |
| —White | 03VP6000 | | |
| 2013 - 07/2015 | | | |
|  | | | |
| Monumental DH Egress Hardware Head Mount<br>Includes Strike and Catch with installation screws | 0BUQ0000 | Window Hardware | |
| 04/2007 - Current | | | |
|  | | | |
| Monumental DH Egress Hardware Sill Mount<br>Includes Strike and Catch with installation screws | 0BUR0000 | Window Hardware | |
| 08/1999 - Current | | | |
|  | | | |
| Monumental DH Egress Hardware Stool Mount<br>Includes Strike and Catch with installation screws | 0BUT0000 | Window Hardware | |
| 2000 - Current | | | |

## Pella® Reserve™ and Architect Series® Single/Double-Hung


index
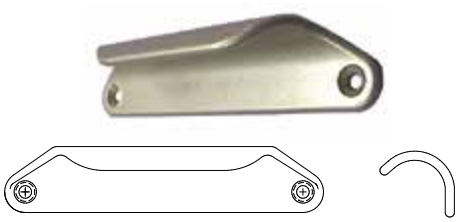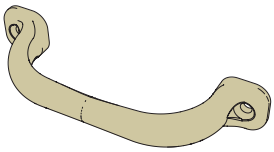
| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
|  DS/PL(Cur)/AS Monumental (Pre July 2015) DH, Sash Lift (Pkg 1) (Pre 07/2015) | | Sash/Panel Parts | Sash Lifts/ Covers/ Operators |
| —Antique Brass | No Longer Available | | |
| —Brass | 0F370001 | | |
| —Brown | 0F374000 | | |
| —Champagne | 0F370003 | | |
| —Distressed Bronze | 0F37DB00 | | |
| —Distressed Nickel | 0F37DN00 | | |
| —Matte Black | 0F37MB00 | | |
| —Oil Rubbed Bronze | 0F37BZ01 | | |
| —Polished Chrome | 0F37C000 | | |
| —Polished Nickel | No Longer Available | | |
| —Satin Brass | 0F37SB00 | | |
| —Satin Nickel | 0F37P000 | | |
| —White | 0F370000 | | |
| 1995 - 12/2004 | | | |
|  AS DH Sash Lift | | Sash/Panel Parts | Sash Lifts/ Covers/ Operators |
| —Antique Brass | No Longer Available | | |
| —Brass | 0CST5000 | | |
| —Brown | 0CST4000 | | |
| —Champagne | 0CSTD000 | | |
| —Distressed Bronze | 0CSTDB00 | | |
| —Distressed Nickel | 0CSTDN00 | | |
| —Matte Black | 0CSTMB00 | | |
| —Oil Rubbed Bronze | 0CSTBZ01 | | |
| —Satin Brass | 0CSTSB00 | | |
| —Satin Nickel | 0CSTP000 | | |
| —White | 0CST6000 | | |
| 2005 - Current | | | |
|  AS Double Hung, Single Hung Limited Opening Hardware | 061G0000 | Sash/Panel Parts | WOCD/ Limited Opening/ Egress |
| 2005 - Current | | | |
|  AS Monumental Hung Limited Opening Hardware | 004Y0000 | Sash/Panel Parts | WOCD/ Limited Opening/ Egress |
| 2005 - Current | | | |

## Pella® Reserve™ and Architect Series® Single/Double-Hung

index


Window Opening Control Device (WOCD)

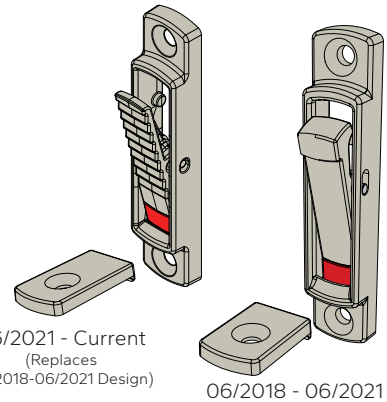


06/2021 - Current
(Replaces 06/2018-06/2021 Design)

06/2018 - 06/2021

| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
| WOCD, AS, Standard, HIG, & Monumental (Model 5 & 6), (Mounted on Sash) | | Sash/Panel Parts | WOCD/ Limited Opening/ Egress |
| —Champagne | 0597D000 | | |
| —White | 05976000 | | |
| —Brown | 05974000 | | |
| —Bright Brass | 05970000 | | |
| —Oil Rubbed Bronze | 0597BZ00 | | |
| —Satin Nickel | 0597P000 | | |
| —Satin Brass | 0597SB00 | | |
| —Matte Black | 0597MB00 | | |
| —Antique Brass | No Longer Available | | |
| 06/2018 - Current | | | |
| WOCD, AS, Standard, HIG & Monumental (Model 4, 5 & 6), (Mounted on Frame) | | Sash/Panel Parts | WOCD/ Limited Opening/ Egress |
| —Chrome | 01KY0003 | | |
| —Oil Rubbed Bronze | 01KY0002 | | |
| —White | 01KY0001 | | |
| Standard 01/2011 - 05/2018<br>HIG 2005 - 05/2018<br>Monumental 07/2015 - 05/2018 | | | |
| WOCD, AS, Monumental - Pre July 2015 (Mounted on Frame) | No Longer Available | | |

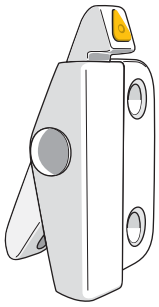


WOCD 01/2011 - 05/2018

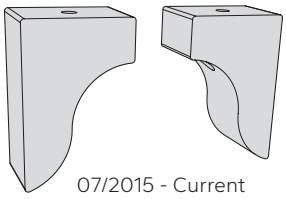

07/2015 - Current

| | | | |
|---|---|---|---|
| AS DH Exterior Sash Lug Set (Qty. 2) Includes installation screws and double-sided foam tape. | | Sash/Panel Parts | Sash Lugs |
| —Black | 01QLG000 | | |
| —Brown | 01QL4000 | | |
| —Classic White | 01QLE000 | | |
| —Poplar White | 01QLL000 | | |
| —White | 01QL6000 | | |
| 07/2015 - Current | | | |






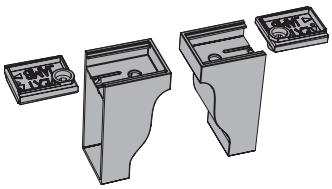


07/2017 - Current

| | PQM location | Reqd. Info |
|---|---|---|
| AS DH Exterior Sash Lug Set (Qty. 2) Includes 2 Lugs, 2 mounts, 1 notice label and installation screws | Sash/Panel | Exterior Color |
| 03/2017 - Current | | |
| AS Monumental Hung Exterior Sash Lug Set (Qty. 2) Includes 2 Lugs, 2 mounts, 1 notice label and installation screws | Sash/Panel | Exterior Color |
| 07/2017 - Current | | |

## Pella® Reserve™ and Architect Series® Single/Double-Hung

index

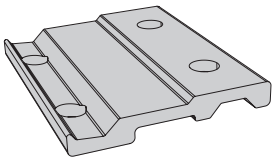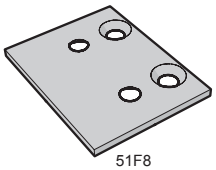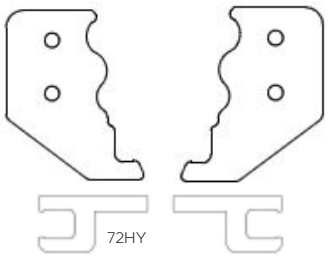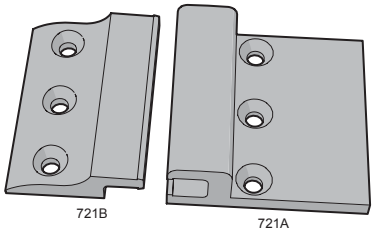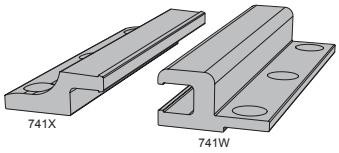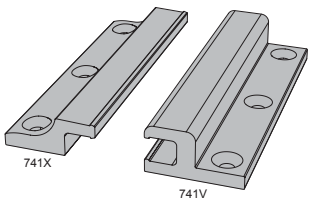
| | | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|---|
|  | AS Monumental Rectangle SH Clips, Pre July 2015<br>Includes 5 clips, #8 x 5/8" screws<br><br>2003 - 07/2015 | No Longer Available (091G) | | |
| <br>51F8 | Curve Top/Angle Top Single-Hung Clips<br>Includes 5 clips, #8 x 5/8" screws<br><br>2003 - 07/2015 | No Longer Available | | |
| <br>72HY | Windload Brace Clips/Strikes Champ AS & DS (1 Pair)<br><br>01/2000 - 02/2005<br>Replaces 1995 - 1999 and 1991 - 1994 vintages | 0BAZ0001 | Frame Parts | Windload Brace Clips |
|  | DH Windload Brace Clip<br><br>1991 - 1994 | No longer available | | |
| <br>721B 721A | AS/DC Windload Brace Clips, MD/MS<br>Includes 20 brace clips (721B), 20 brace strikes (721A), #8 x 1-3/4" screws, #10 x 1" screws, instructions<br>—Champagne<br>—White<br><br>2005 - 07/2015 | <br><br><br>06FX0000<br>No Longer Available | | |
| | AS/DC Windload Brace Clips, CD/CS<br>Includes 20 brace clips (721B), 20 brace strikes (72HY), #8 x 1-3/4" screws<br>—Champagne<br>—White<br><br>2005 - 07/2015 | <br><br><br>06GM0000<br>No Longer Available | | |
| <br>741X 741W | AS HIG DH Check Rail Brace Clip, White, Jan 2009 - July 2015 (Missile D Check Rail Brace Clip Pkg)<br>Includes 2 pairs of clips (741W, 741X) 10 #8 x 1-3/4" screws, 2 #8 x 1/16" Screws and instructions<br>—Champagne<br>—White<br><br>2009 - 07/2015 | <br><br><br>(060PD000)<br>(060P6000)<br>No Longer Available | | |
| <br>741X 741V | AS HIG DH Bottom Rail Brace Clips, Jan 2009 - July 2015 (Missile D Bottom Rail Brace Clip Pkg)<br>Includes 2 pairs of clips (741V, 741X) 12 #8 x 1-3/4" screws, and instructions<br>—Champagne<br>—White<br><br>2009 - 07/2015 | <br><br><br>(060QD000)<br>(060Q6000)<br>No Longer Available | | |




| | PQM location | Reqd. Info |
|---|---|---|
| Full Screen Only<br><br>02/2011 - Current<br>2010 - 2011<br>03/2007 - 2009<br>2005 - 02/2007<br>03/1999 - 2004<br>1993 - 02/1999<br>1991 - 1992 | Screen Service Items | Frame Width, Frame Height*, Service Type, Screen Color,<br><br>*Make Height required for Precision Fit |
| Half Screen Only<br><br>02/2011 - Current<br>2010 - 2011<br>03/2007 - 2009<br>2005 - 02/2007<br>03/1999 - 2004<br>1995 - 02/1999<br>1993 - 1994<br>1991 - 1992 | Screen Service Items | Frame Width, Frame Height*, Service Type, Screen Color,<br><br>*Make Height required for Precision Fit |
| Half Screen Retaining Clip<br><br>1991 - Current | Screen Service Items | Frame Width, Frame Height, Service Type, Screen Color, |










| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
| Screen Retaining Clip, (5) Package of 5, 49" lineals<br>—Brown<br>—Tan<br>—White<br><br>1991 - Current | <br>0FB64049<br>0FB6B049<br>0FB66049 | Screen Parts | Clips |
| Black Screen Spline<br>—100 ft. roll<br><br>1991 - Current | 06F10001 | Screen Parts | Screen Spline |
| InView™ Fiberglass Screen Cloth (100 ft. roll)<br>–36" Wide<br>–48" Wide<br><br>1991 - Current | <br>052M0000<br>052M0001 | Screen Parts | Screen Cloth |
| Replacement Screen Channel (Pkg 15)<br>—Brown<br>—Hartford Green<br>—Poplar White<br>—Putty<br>—Tan<br>—White<br><br>2005 - Current | No Longer Available (005H) | | |
| Screen Pull Tab<br>—box 10<br><br>1997 - Current | 0BPL0001 | Screen Parts | Pull Tabs |

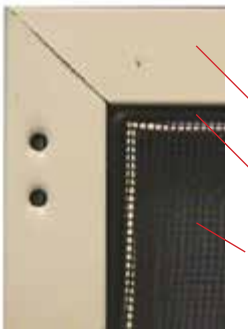

## Pella® Reserve™ and Architect Series® Single/Double-Hung

index

| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
|  D2 Screen Catch<br>–LH (box 50)<br>–RH (box 50)<br>–2 each RH/LH<br><br>1993 - Current | <br>0CDH0000<br>0CDJ0000<br>0CDH0001 | Screen Parts | Screen Catch |
|  DS Screen Clip, DH<br><br>–RH (50)<br>–LH (50)<br><br>1993 - Current | No Longer Available<br><br>(0CDF0000)<br>(0CDG0000) | | |
|  AS HIG DH & MH, 1" Screen Clip, July 2015 - Cur, (5 Sets 2)<br><br>07/2015 - Current | 207R0000 | Screen Parts | Clips |
|  AS Model 5 Upper Screen Clip (10)<br><br>02/2011 - Current | 01Q00000 | Screen Parts | Clips |
|  AS DH Model 3 & 5 Upper Screen Clip 1" (10)<br><br>2005 - Current | 01V10000 | Screen Parts | Clips |
|  ASDH3 Full Screen Upper Clip (Qty. 10)<br><br>2009 - 2011 | 0D7R0000 | Screen Parts | Clips |
| ASDH3 Screen Wrap Around Stile Clips (Qty. 10 LH,10 RH)<br><br>2005 - 2011 | 0D7Q0000 | Screen Parts | Clips |
|  AS Wood Model 5 RH/LH Scr Clip (10 each)<br><br>02/2011 - Current | 01Q10000 | Screen Parts | Clips |
| ASDH3 Screen Shim (Pkg 50)<br>1" x 5/16" x 1/16", adhesive backed polyethylene shims<br><br>2005 - 2011 | 0DRY0050 | Screen Parts | Screen Keeper/ Keeper Kit/ Shims |
|  ASDH3 Screen Angled Textile Weatherseal (50")<br><br>2005 - 2011 | 0D7P0000 | Screen Parts | Bugstrip/ Weatherstrip |
|  ASDH3 Half Screen Textile Weatherseal Kit (Qty. for 1 Unit)<br><br>2005 - 2011 | 0D7N0000 | Screen Parts | Bugstrip/ Weatherstrip |

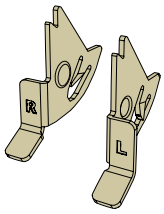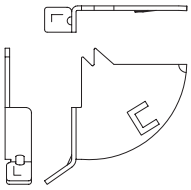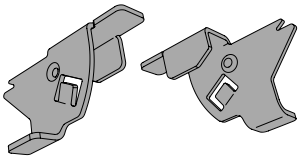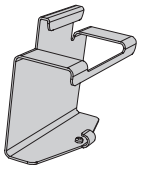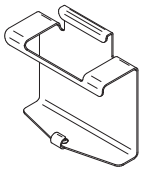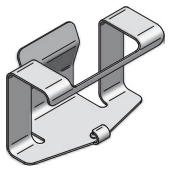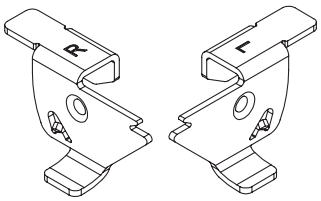
## Pella® Reserve™ and Architect Series® Single/Double-Hung

index

| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
|  Screen Latch & Clip, DH Full Screen (20)<br><br>1991 - 12/2004 | No Longer Available | | |
|  Screen Latch & Clip Assy. (20)<br><br>1991 - 1992 | No Longer Available (0E88) | | |
| Screen Retaining Screw Assy., WT (100)<br><br>1991 - 1992 | 0E890000 | Screen Parts | Screen Screws |
|  Screen Safety Cable Assy., DH Half Screen<br><br>1991 - 12/2004 | 051V0000 | Screen Parts | Screen Carriage/ Carriage Stop |
|  Screen Hardware Pkg. DH Full Screen<br><br>1991 - 12/2004 | No Longer Available (06B8) | | |
|  DH Half Screen Strike (Use on wood units only).<br><br>1993 - 12/2004 | No Longer Available | | |


## Pella® Reserve™ and Architect Series® Single/Double-Hung

index
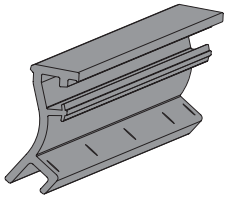
| | PQM location | Reqd. Info |
|---|---|---|
|  Integrated Rolscreen® Sill Front Cover<br><br>August 2018 - Current | Frame Service Item | Frame Width, Finish |
|  Integrated Rolscreen® Checkrail Bristle Strip<br><br>August 2018 - Current | Sash/Panel Service Item | Frame Width |
|  Upper Integrated Rolscreen® Cartridge<br><br>August 2018 - Current | Screen Service Item | Frame Width |
|  Lower Integrated Rolscreen® Assembly<br><br>August 2018 - Current | Screen Service Item | Frame Width |
|  AS DH Rolscreen Sill Receptor<br><br>August 2018 - Current | Screen Service Item | Frame Width |


| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
|  Integrated Rolscreen Checkrail Mohair Pad (Qty 2)<br><br>August 2018 - Current | 05CM0000 | Screen Parts | Rolscreen Parts |
|  Integrated Rolscreen Magnet Assembly<br>(Qty 2)<br>3 magnets used on frame widths ≥ 37" - Order 2 packages.<br><br>August 2018 - Current | 05CT0000 | Screen Parts | Rolscreen Parts |
|  Integrated Rolscreen Bottom Rail Bristle Strip (48")<br><br>August 2018 - Current | 05CX0000 | Screen Parts | Rolscreen Parts |

## Double-Hung Fixed Parts

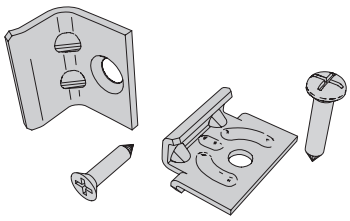






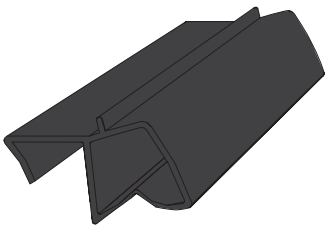

| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
| PL, DS, AS Casement Brace Clip Replacement Kit<br><br>03/2005 - Current | 0B4H0003 | Frame Parts | Windload Brace Clips |
| DH Fix Sill Stop Extension 53<br><br>1995 - Current | No Longer Available (DHFX) | | |
| DH Fix Sill Stop Extension 59<br><br>1995 - Current | No Longer Available (DHFX) | | |
| Rainstrip 70" (25)<br><br>03/2005 - Current | 0CN90000 | Weatherstrip/ Gasket/Mohair | |


| | PQM location | Reqd. Info |
|---|---|---|
| Frame Weatherstrip<br>1 Set<br><br>03/2005 - Current | Frame Service Items | Frame Width, Frame Height |
| Fixed Sash<br>(Qty. – 1)<br><br>03/2005 - Current | Sash/Panel Service Items | Frame Width, Frame Height, Glazing, Exterior Color, Interior Finish, Hardware Finish |
| Cladding Set<br>Qty.-1<br><br>03/2005 - Current | Sash/Panel Service Items | Frame Width, Frame Height, Color |

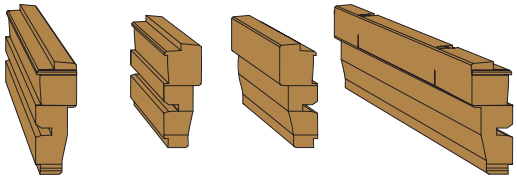

| | PQM location | Reqd. Info |
|---|---|---|
| Fixed Stops<br><br>1995 - Current<br>1991 - 1994 | Frame Service Items | Frame Width, Frame Height, finish/color |



| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
| CM Fix Lock Pin<br><br>03/2002 - Current<br>Note: Replaces pre 03/2002 pins. | 0CXJ0000 | Window Hardware | Lock Strikes/ Keepers/ Covers |

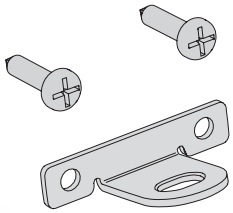

| | | | |
|---|---|---|---|
| 907 CM Fix Sash Strike<br>–Pkg 1<br>–Pkg 50<br><br>1997 - Current | <br>0BFS0001<br>0BFS0050 | Sash/Panel Parts | Sash/Panel Strikes |



905 CM Fix Sash Strike

| | | | |
|---|---|---|---|
| 905 CM Fix Sash Strike<br><br>1995 - 1996 | 0BLU0001 | Sash/Panel Parts | Sash/Panel Strikes |



| | | | |
|---|---|---|---|
| 904 CM Fix Sash Catch w/screws<br><br>1994 | No Longer Available (0CXF) | | |



| | | | |
|---|---|---|---|
| 903 Arch Series Fix Sash Clip Pkg (10)<br><br>1993 | No Longer Available (0BFP) | | |



| | | | |
|---|---|---|---|
| CM LG Fix Sash Strap w/screws<br><br>1994 - Current | 0CXG0000 | Sash/Panel Parts | Sash Stops/ Sash Straps |




| | | | |
|---|---|---|---|
| Hinge Hardware, Fixed 95<br><br>1995 - 1999 | No Longer Available | | |



| | | | |
|---|---|---|---|
| Package Two Fixed Hinge Hardware<br><br>1994 | No Longer Available | | |



| | PQM location | Reqd. Info |
|---|---|---|
| Removable Traditional Muntin | GRILLE ONLY | |
| 02/2011 - Current | | |
| 2005 - 01/2011 | | |
| Pre 2005 | | |

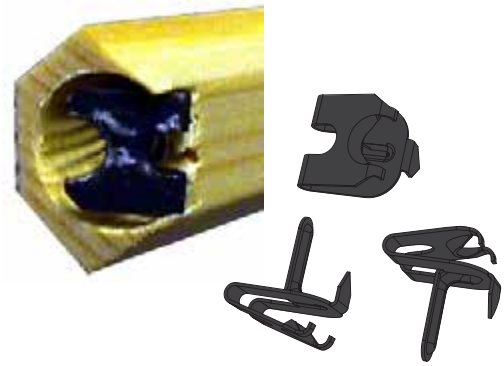

| | Part Number | Catalog Category | Catalog Subcategory |
|---|---|---|---|
| Muntin Clip | | Grille Parts | |
| –(Pkg 100) | 0CFP0000 | | |
| –(Pkg 10) | 0CFP0001 | | |
| 1995 - 03/2005 | | | |



| | | | |
|---|---|---|---|
| Classic Muntin Tack | | Grille Parts | |
| –(Pkg 1000) | 0B0K0000 | | |
| –(Pkg 10) | 0B0K0001 | | |
| 1995 - 03/2005 | | | |